



Calhoun: The NPS Institutional Archive
DSpace Repository

Theses and Dissertations

1. Thesis and Dissertation Collection, all items

1994-06

An analysis of the costs and benefit in
improving the T56-A-427 interconnector
harness end and mating thermocouple end
connector under the aircraft engine
Component Improvement Program (CIP)

Murphy, Thomas Joseph

Monterey, California. Naval Postgraduate School

<http://hdl.handle.net/10945/27950>

Downloaded from NPS Archive: Calhoun



Calhoun is the Naval Postgraduate School's public access digital repository for research materials and institutional publications created by the NPS community. Calhoun is named for Professor of Mathematics Guy K. Calhoun, NPS's first appointed -- and published -- scholarly author.

Dudley Knox Library / Naval Postgraduate School
411 Dyer Road / 1 University Circle
Monterey, California USA 93943

<http://www.nps.edu/library>

DUDLEY KNOX LIBRARY
NAVAL POSTGRADUATE SCHOOL
MONTEREY CA 93943-5101

Approved for public release; distribution is unlimited.

An Analysis of the Costs And Benefits In Improving The T56-A-427
Interconnector Harness End And Mating Thermocouple End Connector Under
The Aircraft Engine Component
Improvement Program (CIP)

by

Thomas Joseph Murphy
Lieutenant Commander, United States Navy
B.S., United States Naval Academy, 1983

Submitted in partial fulfillment
of the requirements for the degree of

MASTER OF SCIENCE IN MANAGEMENT

from the

NAVAL POSTGRADUATE SCHOOL

June 1994

REPORT DOCUMENTATION PAGE

Form Approved OMB No. 0704

Public reporting burden for this collection of information is estimated to average 1 hour per response, including the time for reviewing instruction, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden, to Washington Headquarters Services, Directorate for Information Operations and Reports, 1215 Jefferson Davis Highway, Suite 1204, Arlington, VA 22202-4302, and to the Office of Management and Budget, Paperwork Reduction Project (0704-0188) Washington DC 20503.

1. AGENCY USE ONLY (Leave blank)		2. REPORT DATE June 1994		3. REPORT TYPE AND DATES COVERED Master's Thesis	
4. TITLE AND SUBTITLE AN ANALYSIS OF THE COSTS AND BENEFITS IN IMPROVING THE T56-A-427 INTERCONNECTOR HARNESS END AND MATING THERMOCOUPLE END CONNECTOR UNDER THE AIRCRAFT ENGINE COMPONENT IMPROVEMENT PROGRAM (CIP)				5. FUNDING NUMBERS	
6. AUTHOR(S) MURPHY, THOMAS JOSEPH					
7. PERFORMING ORGANIZATION NAME(S) AND ADDRESS(ES) Naval Postgraduate School Monterey CA 93943-5000				8. PERFORMING ORGANIZATION REPORT NUMBER	
9. SPONSORING/MONITORING AGENCY NAME(S) AND ADDRESS(ES)				10. SPONSORING/MONITORING AGENCY REPORT NUMBER	
11. SUPPLEMENTARY NOTES The views expressed in this thesis are those of the author and do not reflect the official policy or position of the Department of Defense or the U.S. Government.					
12a. DISTRIBUTION/AVAILABILITY STATEMENT Approved for public release; distribution is unlimited.				12b. DISTRIBUTION CODE *A	
13. ABSTRACT (maximum 200 words) This thesis is a study validating the cost effectiveness of the Component Improvement Program for aircraft engines. It determines the costs and benefits derived from the Navy incorporating Power Plant Change 111 which improved the interconnector harness end and mating thermocouple end connector of the T56-A-427 engine. Useful maintenance data pertaining to this component was extracted from the Naval Logistics Data Analysis (NALDA) system. Cost data pertaining to the Power Plant Change was taken from two sources, the Manufacturer's Engineering Program Description (EPD) and the Naval Air System Command's Configuration Change Control Board (CCCB) document. Based on the author's analysis, the improvement to the interconnector harness end and mating thermocouple end connector was cost-effective from both a financial break-even point in that the cost to produce the improvement will be recovered after three years, and from a Net Present Value analysis on this improvement which shows that the U.S. Navy will save more than \$400,000 during the expected fifteen-year life cycle of the engine.					
14. SUBJECT TERMS Aircraft Engine Component Improvement Program, Engineering Change Proposals, Power Plant Change, Navy				15. NUMBER OF PAGES 88	
				16. PRICE CODE	
17. SECURITY CLASSIFICATION OF REPORT Unclassified	18. SECURITY CLASSIFICATION OF THIS PAGE Unclassified	19. SECURITY CLASSIFICATION OF ABSTRACT Unclassified	20. LIMITATION OF ABSTRACT UL		

NSN 7540-01-280-5500

Standard Form 298 (Rev. 2-89)

Prescribed by ANSI Std. Z39-18

ABSTRACT

This thesis is a study validating the cost effectiveness of the Component Improvement Program for aircraft engines. It determines the costs and benefits derived from the Navy incorporating Power Plant Change 111 which improved the interconnector harness end and mating thermocouple end connector of the T56-A-427 engine. Useful maintenance data pertaining to this component was extracted from the Naval Logistics Data Analysis (NALDA) system. Cost data pertaining to the Power Plant Change was taken from two sources, the Manufacturer's Engineering Program Description (EPD) and the Naval Air System Command's Configuration Change Control Board (CCCCB) document. Based on the author's analysis, the improvement to the interconnector harness end and mating thermocouple end connector was cost-effective from both a financial break-even point in that the cost to produce the improvement will be recovered after three years, and from a Net Present Value analysis on this improvement which shows that the U.S. Navy will save more than \$400,000 during the expected fifteen-year life cycle of the engine.

172.15
18 9677
C.1

TABLE OF CONTENTS

I.	INTRODUCTION	1
A.	BACKGROUND	1
B.	OBJECTIVES	2
C.	SCOPE AND LIMITATIONS	3
D.	THESIS PREVIEW	3
II.	LITERATURE REVIEW AND PREVIOUS RESEARCH	5
A.	POLICY OPTIONS FOR THE AIRCRAFT TURBINE ENGINE COMPONENT IMPROVEMENT PROGRAM	5
B.	EVALUATION OF AIRCRAFT TURBINE ENGINE COMPONENT REDESIGNS	6
C.	AN ANALYSIS OF THE AIRCRAFT ENGINE COMPONENT IMPROVEMENT PROGRAM (CIP): A LIFE CYCLE COST APPROACH	10
D.	PRELIMINARY ANALYSIS OF THE J-52 AIRCRAFT ENGINE COMPONENT IMPROVEMENT PROGRAM	11
E.	AN ANALYSIS OF THE CORRELATION BETWEEN THE J-52 COMPONENT IMPROVEMENT PROGRAM AND IMPROVED MAINTENANCE PARAMETERS	12

F.	AN ANALYSIS OF THE COST AND BENEFITS IN IMPROVING THE J-52 FUEL PUMP MAIN GEAR SPLINE DRIVE UNDER THE AIRCRAFT ENGINE COMPONENT IMPROVEMENT PROGRAM (CIP)	13
III.	BACKGROUND	18
A.	T56-A-427 ENGINE TECHNICAL DESCRIPTION	18
B.	COMPONENT IMPROVEMENT PROGRAM FUNDING FOR THE T56 ENGINE	21
C.	THE COMPONENT IMPROVEMENT PROGRAM FUNDING PROCESS TO CREATE POWER PLANTS CHANGE 111	24
D.	DETERMINING A CANDIDATE FOR STUDY	26
E.	THE METHODOLOGY FOR COLLECTING MAINTENANCE DATA FOR PPC 111	30
F.	VALIDATION OF THE METHODOLOGY FOR MAINTENANCE DATA COLLECTION	35
G.	OTHER MAINTENANCE MANHOURS ASSOCIATED WITH PPC 111	37
H.	NO MAINTENANCE MANHOURS TO INSTALL PPC 111	39
IV.	PRESENTATION OF BEFORE-AND-AFTER LIFE CYCLE COSTS	41
A.	BACKGROUND	41
B.	ACTUAL COSTS OF THE R&D AND APN INVESTMENTS ASSOCIATED WITH PPC 111	42
C.	LABOR RATES FOR "O" LEVEL AND "I" LEVEL MAINTENANCE	44

D.	CURRENT CONFIGURATION TOTAL ANNUAL LIFE CYCLE COSTS (PPC 111 NOT INCORPORATED)	44
E.	MODIFIED CONFIGURATION TOTAL ANNUAL LIFE CYCLE COSTS (PPC 111 INCORPORATED)	49
V.	COMPARISON AND ANALYSIS OF THE TWO LIFE CYCLE MODELS	55
A.	BREAK-EVEN POINT ANALYSIS	55
B.	NET PRESENT VALUE ANALYSIS	57
VI.	SUMMARY, CONCLUSIONS AND RECOMMENDATIONS	60
A.	SUMMARY	60
B.	CONCLUSIONS	62
C.	RECOMMENDATIONS	63
	LIST OF REFERENCES	65
	APPENDIX A	69
	APPENDIX B	74
	APPENDIX C	77
	DISTRIBUTION LIST	79

LIST OF FIGURES

Figure 2.1. Generic CIP Milestones Timeline.	7
Figure 2.2. Component Selection Diagram.	9
Figure 3.1. Thermocouple Interconnector Harness End and Mating Thermocouple End Connector.	22
Figure 3.2. Navy CIP Funding.	23

LIST OF TABLES

Table 3.1. NAVY T56 ENGINE CIP FUNDING.	24
Table 3.2. TOTAL MAINTENANCE MANHOUR AND EVENTS SUMMARY.	37
Table 3.3. ADDITIONAL MAINTENANCE MANHOURS AND EVENTS SUMMARY.	39
Table 4.1. CURRENT CONFIGURATION TOTAL ANNUAL LIFE CYCLE COSTS	45
Table 4.2. MODIFIED CONFIGURATION (PPC 111 INCORPORATED) TOTAL ANNUAL LIFE CYCLE COSTS	50
Table 5.1. BREAK-EVEN ANALYSIS	56
Table 5.2. NET PRESENT VALUE ANALYSIS	58

I. INTRODUCTION

A. BACKGROUND

The Component Improvement Program (CIP) is the Department of Defense's program to improve safety, reliability, and maintainability for aircraft engines, propellers and power systems. The CIP provides for continuing improvement in aircraft engine hardware, procedural safety, reliability, maintainability and corrective action of service-related deficiencies after the first procurement funded aircraft has been accepted. [Ref. 1] Continuing over the life of the aircraft engine, the CIP ensures that older inventory aircraft engines remain operational.

This thesis is a study of the Navy's Engine CIP and more specifically, a study of the Navy's CIP effort on the T56-A-427 engine used on the E-2C(plus) Hawkeye aircraft. Over all, this thesis will determine the costs and benefits associated with improving the interconnector harness end and mating thermocouple end connector used on the T56-A-427 engine, which was improved through the CIP.

This thesis is a continuation of on-going research on aircraft logistics support at the Naval Postgraduate School started in 1990 at the request of N-881, the Naval Aviation Maintenance Division of the office of the Assistance Chief of

Naval Operations (Air Warfare), and AIR-536, the Propulsion and Power Division of the Naval Air Systems Command. This request for research has been generated by the fact that no new tactical Navy aircraft are expected until the year 2005, and except for the F/A-18, all current inventory types are out of production. [Ref. 2]

Several thesis research projects have been completed at the Naval Postgraduate School concentrating on the CIP and its effects on engine reliability, maintainability and durability. These projects have focused on quantifying both the CIP investment cost and the resulting savings during the life cycle after a modification to a component on the engine has been made. One of the major goals of the Naval Postgraduate School's research effort is to validate that the CIP for aircraft engines is cost-effective.

B. OBJECTIVES

The objectives of this thesis are:

1. To understand the process that currently exists in the CIP that allows for funding of certain Engineering Change Proposals (ECP) over other ECP's.
2. To determine how much CIP and O&MN money was spent to design and implement one high impact ECP for the T56-A-427 engine, and to determine what, if any, were the problems associated with its implementation.
3. To measure the maintenance manhours and material costs for the selected component before and after the CIP funds were expended and relate the costs of the improvement with the benefits that it provided.

4. To compare the CIP costs with the actual and projected life cycle cost savings resulting from the component's improvement.

C. SCOPE AND LIMITATIONS

This thesis focuses on the T56-A-427 engine used on the Navy's E-2C(plus) Hawkeye aircraft. This engine was chosen because it is the latest major improvement to the long line of T56 series engines and data on the engine is being monitored closely by the Fleet Introduction Team (FIT) located at the Naval Air Station Miramar, California. More specifically, this research focuses on the costs and projected benefits which have resulted from improving the interconnector harness end and the mating thermocouple end connector. The changes were made to this component to better withstand the vibration and high temperature environment found inside the engine nacelle which were the two main reasons why the old component failed so often. This CIP project was one of ten T56-A-427 CIP projects of the Allison Gas Turbine Division of the General Motors Corporation during the fall of 1991. [Ref. 3] The limitations to this research is that it only looks at this one improvement to this one component of the T56-A-427 engine.

D. THESIS PREVIEW

Chapter II provides literature review on previous thesis research efforts focusing on the CIP and their conclusions.

Chapter III provides a brief technical description of the T56-A-427 engine, CIP funding involving the T56 engine, the ECP selected for this research, the methodology used for the actual collection of maintenance data, and presentation of the maintenance data. Chapter IV contains a life cycle cost (LCC) analysis of two models; one without the ECP modification incorporated and one with the ECP incorporated. Chapter V is a break-even and Net Present Value analysis of the differences in the costs between the two models presented in Chapter IV. Finally, Chapter VI presents a summary, conclusions, and recommendations for future study.

II. LITERATURE REVIEW AND PREVIOUS RESEARCH

This chapter presents a review of previous research done on the CIP. The author begins this review with a report done by the Institute for Defense Analysis that is critically important to CIP research. The remaining review focuses on the thesis research done on the CIP at the Naval Postgraduate School.

A. POLICY OPTIONS FOR THE AIRCRAFT TURBINE ENGINE COMPONENT IMPROVEMENT PROGRAM

A paper prepared by the Institute for Defense Analyses (IDA) for the Under Secretary of Defense (Acquisition) investigated the possibility of transitioning CIP to the private sector, the role of CIP overall, the costs and benefits of the CIP program, and the policy options of competing CIP funding. [Ref 4] The paper's authors, Nelson, Harmon and Tyson, describe in detail the role of CIP as an integrated effort that exceeds the maturation period of the aircraft engine following Full Scale Development (FSD). These authors describe the function of the CIP as being an engineering and design effort, which includes the testing and manufacturing of parts and also the management of the integration of the parts into the engine. They explain in detail the resources required to accomplish a CIP task that

includes a design team, a database, and also a plan for integration of long range objectives for the engine program over its life time. The authors show that the value of CIP, this being the cost to the military, 'has declined significantly, largely due to improvements in the full scale development process, the elimination of performance growth and new application objectives for CIP. For these reasons, they conclude that cost savings obtained from CIP efforts significantly outweigh CIP costs. The authors list the current CIP objectives as being:

To correct safety of flight problems, service revealed deficiencies in operational use, and failures induced early in accelerated mission testing and lead the force operations.

To improve durability, reliability, maintainability, producibility, and repairability.

To reduce parts costs, engine costs, and life cycle (including fuel costs).

To improve logistics support planning, integration of total effort to obtain improvements, and the opportunity for new technologies insertion.

To retain performance over the engine lifetime in the inventory.

B. EVALUATION OF AIRCRAFT TURBINE ENGINE COMPONENT REDESIGNS

A thesis written by Sudol and Price was a study that examines some of the problems associated with determining the benefits accrued from CIP. [Ref. 5] The backbone of the thesis was the development of a component selection methodology and an analysis procedure for detecting changes in

the components logistics parameters. The data source the authors used was the Engine Component Information Feedback Report (ECIFR) which is generated from aviation information provided by organizational level maintenance activities and squadrons. Sudol and Price suggested that a component improvement or "Fix" should have completed the Generic CIP Milestone Timeline through T5, shown in Figure 2.1. below, in order for a component to be able to be considered for validating of the CIP.

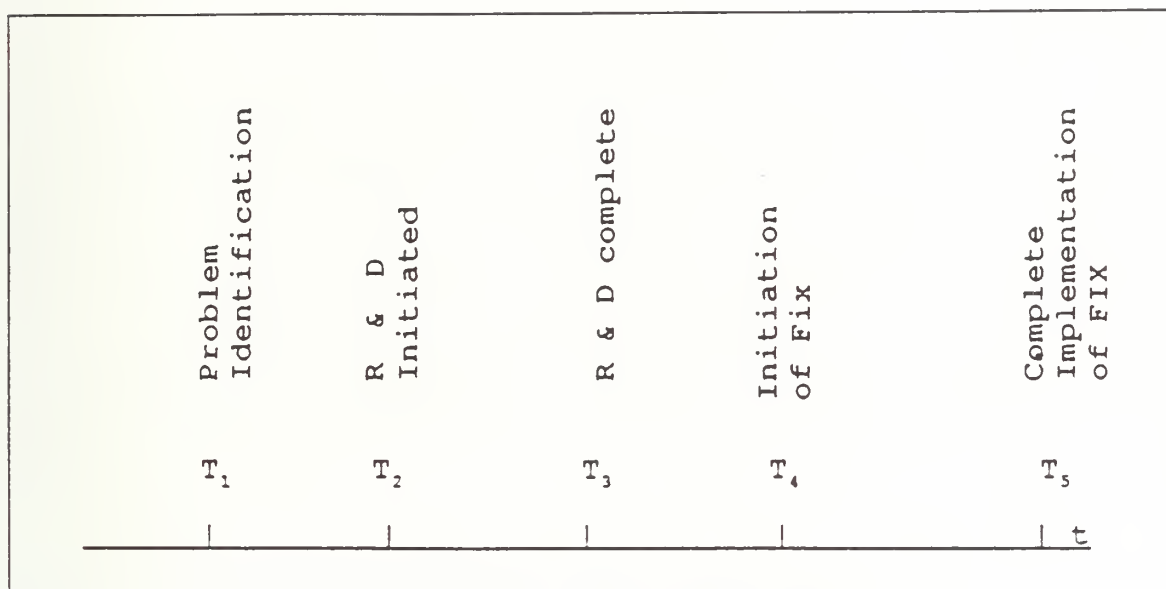


Figure 2.1. Generic CIP Milestones Timeline.

Reaching milestone T5 means that the ECP has been funded, documented as a Power plant Change (PPC), and is fully incorporated throughout the fleet. Also, the authors proposed a logic for selecting a component for study base on historical maintenance data from the ECIFR.

This logic diagram is displayed in Figure 2.2. on the following page. This author has modified it slightly to make it current for the time frame of this writing. Also, what must be noted about the logic diagram is that if the answer to the second decision block question is "no" then it implies that the component was involved in an improvement effort and a change in its historical maintenance data has taken place. Hence, it would be a possible candidate for study.

In their thesis, the authors examined the improvement to one component, the TF-30 Afterburner Igniter Fuel Valve. Using data from organizational and intermediate maintenance activities, the study concluded that the Mean Time Between Failures (MTBF) of the igniter fuel valve had increased from 1000 hours in 1982 to 6000 hours in 1989 because of CIP expenditures. However, throughout the period of time used in their evaluation, several CIP expenditures were made to this component, and the increase in MTBF was gradual. Because of this, the authors posed the question of how to associate a particular increase in engine MTBF with each of the ECPs which had taken place on that engine during the time of study.

Finally, Sudol and Price concluded that first, the CIP program can only be studied at the component level. They based this conclusion on the theory that because of the complex interactions of components attached to an engine, the effects of a specific CIP effort would be lost in the parameters of the system if viewed at the engine level. Secondly, that the

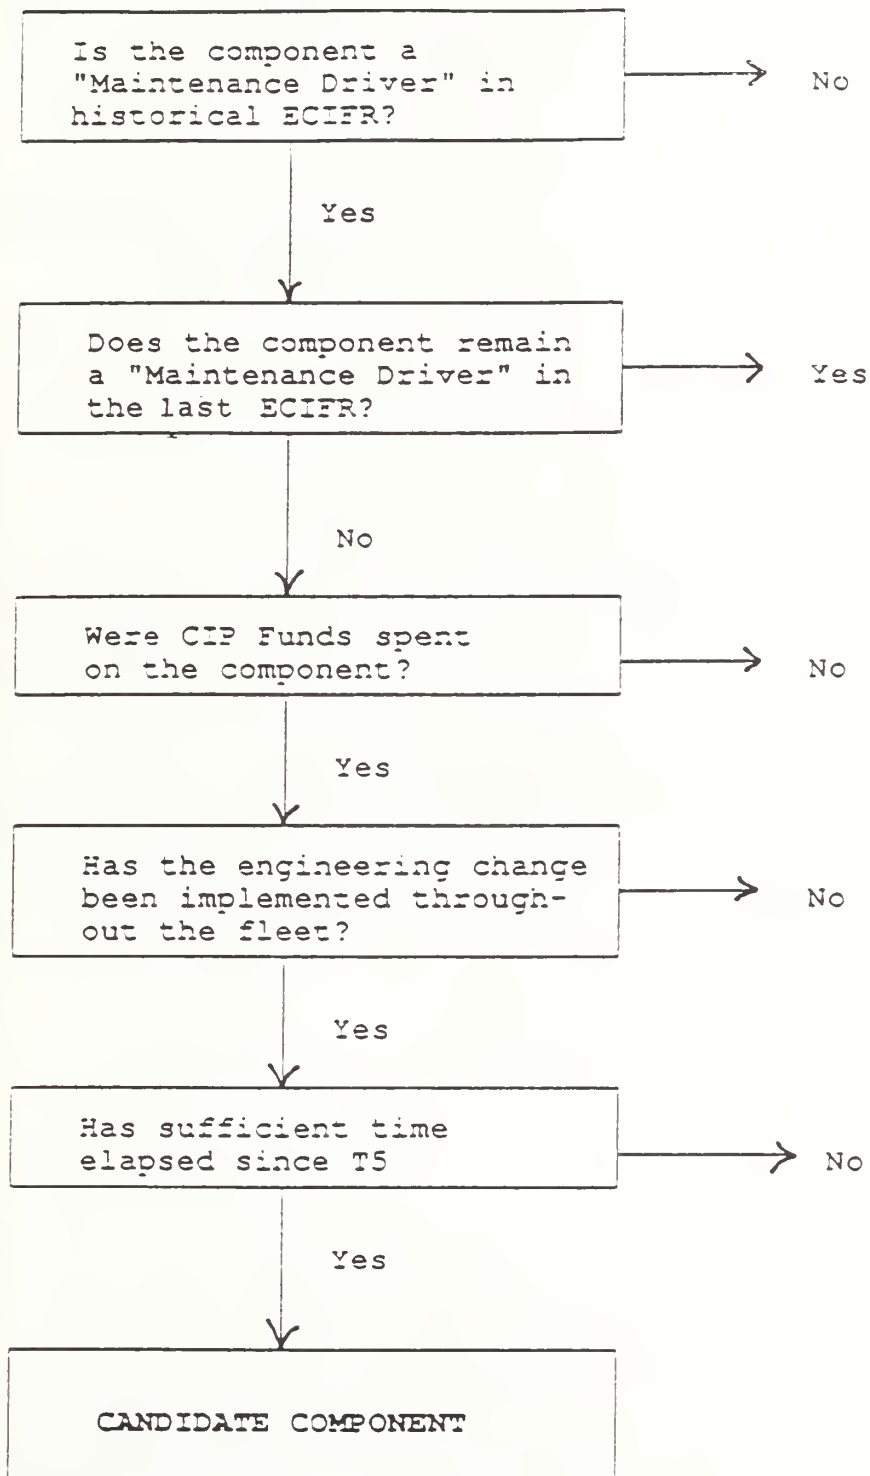


Figure 2.2. Component Selection Diagram.

method of data collection plays a critical role in the ability of the researcher to measure the benefits of a CIP expenditure.

C. AN ANALYSIS OF THE AIRCRAFT ENGINE COMPONENT IMPROVEMENT PROGRAM (CIP): A LIFE CYCLE COST APPROACH

Examining the Aircraft Engine CIP with emphasis on measuring the program's impact on costs at the organizational and intermediate levels of maintenance, Borer [Ref. 6] attempted to identify current LCC models used by the Navy and other services to determine CIP benefits. The database used in this research was the Visibility and Management of Operating and Support Costs (VAMOSC) management information system. That system has changed managers since Borer's writing from NAVAIR (AIR-41114B) to the Navy Center for Cost Analysis (NCA-61). Borer also referred to the ECIFR discussed earlier in this thesis.

Comparing data from seven different aircraft (F-14A, A-7E, P-3C, A-6E, S-3A, EA-6B, E-2C, and KC-130F) from 1984 to 1986, Borer compared Mean Flight Hours Between Maintenance Actions (MFHBMA) and Mean Maintenance Hours per Maintenance Action (MMH/MA) at the organizational and intermediate levels of maintenance to support improvements in aircraft reliability and maintainability. He was able to show that there were improvements in both MFHBMA and MMH/MA at the two levels of maintenance included in the research.

Because Borer concentrated his study at the system level, a strong correlation between specific CIP expenditures and specific improved reliability and maintainability was not possible. Borer stated in his thesis that "The Graphs show a definite improvement trend, but there is no clearly identified cause and effect relations between CIP funds and 3M data." This statement reinforces the observation of Sudol and Price, that in order to validate benefits of the CIP, a researcher must do so at the component level and not at the system level.

D. PRELIMINARY ANALYSIS OF THE J-52 AIRCRAFT ENGINE COMPONENT IMPROVEMENT PROGRAM

Butler's thesis [Ref. 7] presented a preliminary analysis of the J-52 aircraft engine CIP. He was the first to study the J-52 engine. His objectives in the research were to scrutinize the association of the CIP with the promised improvements and benefits pertaining to the J-52 engine, and to determine the obstacles that exist in the databases when attempting to calculate the success or failure of the component modification. Butler also used the ECIFR to plot the changes in the maintenance data concerning Aborts, Engine Caused Aborts, Mean Time Between Failures, Mean Time Between Maintenance Actions, Mean Time To Repair, Maintenance Actions, total Failures, and the Maintenance Manhours for the entire inventory of J-52 engines.

Next, using ten ECP as the analysis base, Butler showed that only one of the ten ECP's, that being an ECP modification to the engine fuel control, could be directly correlated to a tangible increase in the J-52's performance.

Butler used the cost and savings information off of the ECP packages that were sent to him by Pratt and Whitney. Within the ECP package itself, the manufacturing company usually makes long range assumptions as to what they estimate will be the costs and savings from that particular ECP effort.

Butler found it extremely difficult to collect data on the components he selected for study. He examined the NALDA database, the Maintenance, Material, Management (3M) database, and the Aviation Engineering Maintenance System (AEMS) database, but concluded that while the databases were filled with useful information it was too difficult to use. He resorted to the ECIFR report for his reliability and maintainability values.

E. AN ANALYSIS OF THE CORRELATION BETWEEN THE J-52 COMPONENT IMPROVEMENT PROGRAM AND IMPROVED MAINTENANCE PARAMETERS

Continuing the research effort on the J-52 engine, Gordon [Ref. 8] set out with the same objective as Butler; namely, to make a correlation between the CIP dollars spent on the J-52 engine and improved maintenance parameters at the component level. The major focus of his study revolved around developing a methodology to accomplish his objective using existing

databases, open dialogue between the J-52 engine manufacture (Pratt and Whitney), Naval Air Systems Command (NAVAIRSYSCOM), and various Naval Aviation Depot (NADEP) engineers. Gordon was able to construct a methodology using the ECIFR to track Failure Maintenance Actions on five components of the J-52 engine. He targeted his research towards the Failure Maintenance Actions because he felt that it displayed a greater measure of reliability of the engine. Gordon's research effort, as with his predecessors, was unsuccessful in tracking CIP dollars invested on the J-52 for any specific ECP effort.

F. AN ANALYSIS OF THE COST AND BENEFITS IN IMPROVING THE J-52 FUEL PUMP MAIN GEAR SPLINE DRIVE UNDER THE AIRCRAFT ENGINE COMPONENT IMPROVEMENT PROGRAM (CIP)

Jones, [REF. 9] continued the research of Butler and Gordon on the J-52 engine. The major objective of Jones was to develop a methodology for extracting maintenance data from the NALDA system and use it to determine the financial Net Present Value and break-even point of a CIP effort. He selected the fuel pump main gear spline drive of the J-52 because this part had only one ECP preformed on it since 1979. With some very extensive investigating, Jones was able to use the NALDA system to determine the number of maintenance actions required on this part prior to the installation of the PPC, the action item document issued to the fleet following a ECP,

and also the number of maintenance actions required after the installation.

Using the Equipment Condition Analysis (ECA) "0520" Report, Jones was able to extract the specific maintenance data related to the J-52 fuel pump both before-and-after the PPC was issued. Also, because he was tracking a change that involved maintenance work at the Depot level, Jones used the ECA "301" Report to track fuel pumps that had arrived at the Depot maintenance facility still attached to an engine. Because these two reports list the type of maintenance action taken and the type of malfunction code applied to the fuel pump main gear spline drive, Jones was able to determine the details of the before-and-after maintenance actions very accurately.

Financial data for the fuel pump main gear spline drive modification was acquired from AIR-536, the Naval Aviation Depot Facility (NADEP) Jacksonville, and the engine contractor, Pratt and Whitney. Jones discovered that two key documents were required in order to calculate the total amount of dollars expended on the modification. The total amount of Research Development Test and Evaluation (RTD&E) dollars expended by Pratt & Whitney was revealed on the finalized version of the EPD. The EPD is the contractor's program objective, proposed solution and development schedule for the modification. Jones discovered that once AIR-536 issues the Power Plant Change that the contractor would close out their

books on the project and, in so doing, tally the total amount of RTD&E dollars expended on the finalized version of the EPD.

Jones also discovered that the Aircraft Procurement Navy and Operations and Maintenance Navy (APN and O&MN) dollars expended by AIR-536 to buy the modification kits and pay for the installation comes from the Cost and Funding Schedule produced by the NAVAIR Configuration Change Control Board (CCCB). Described in detail in his thesis, Jones lays out the eight steps of the CCCB process, taken from the NAVAIR Configuration Management Policy, NAVAIRINST. 4130.1C, dated January 1992, to be:

Step 1. AIR-1006 (Configuration and Data Management Branch) receives the ECP from AIR-536 and enters it into the Modification Management Information System (MODMIS).

Step 2. After entry into MODMIS, AIR 1006 forwards the ECP to the office of primary responsibility (AIR-536).

Step 3. AIR-536 convenes a Change Proposal Evaluation and Planning Conference with representatives from the following NAVAIR codes:

- a. AIR-02 - to determine the method of contracting.
- b. AIR-04 - to determine if the change is supportable and ensure all issues regarding the retrofit are addressed.
- c. AIR-05 - to review the technical content of the ECP.
- d. AIR-114 - to determine any impact the ECP will have on the production requirements.
- e. PMA 205 - to determine if training requirements have been identified.

Step 4. AIR-536 then issues a decision memorandum if the decision is made, based on the results of step 3, to process the ECP.

Step 5. AIR-536 assembles a Change Control Board Package which includes inputs from all matrix organization members. Among the items included in this package are the following:

- a. CCCB Change request,
- b. Cost and Funding Schedule,
- c. Milestone Chart,
- d. Implementation Forms which assign implementation responsibilities,
- e. Government Furnished Equipment Listing,
- f. Support Equipment Requirements Form,
- g. AIR-04 routing and concurrence form,
- h. AIR-05 routing and concurrence form,
- i. Controlling Custodian (TYCOM)
[COMNAVAIRPAC/COMNAVAIRLANT] concurrence form,
- j. System Safety Assessment Form.

Step 6. The Matrix staffing process, which assigns persons within the matrix organization to the ECP processing effort is completed.

Step 7. After all the required signatures are obtained, AIR-536 will submit the completed CCCB package to AIR-1006, who will update the MODMIS system and schedule the ECP for a formal Change Control Board meeting.

Step 8. The CCCB convenes its scheduled meeting and either approves or disapproves the ECP.

Having investigated all the funding sources associated with the fuel pump main gear spline drive modification, and having calculated all of the maintenance performed on this one component, Jones constructed a life cycle cost analysis of his data in terms of costs and savings and then calculated a break-even point for the CIP effort.

The work of Jones in both the areas of financial data and maintenance data collection, provided a major breakthrough in the Naval Postgraduate School's attempts to validate the CIP. In particular, his methodology for extracting maintenance data from the NALDA system produced the most reliable maintenance support data to date.

It is the objective of this author to take as much as possible, the methodology of Jones and apply it to a different powerplant system, specifically the T56-A-427, and to consider a single component of that engine to provide AIR-536 with another case study validating the CIP.

III. BACKGROUND

The purpose of this chapter is to provide the reader with insight as to the mechanical operation behind a turboprop engine to understand the importance of the component chosen for study. It also provides information on the administrative funding process at Naval Air Systems Command associated with the PPC chosen as the candidate for study. Next, the author presents a detailed narrative of the author's research experiences in developing his methodology for maintenance data collection pertaining to PPC 111. Finally, the last section of this chapter displays the collected maintenance data.

A. T56-A-427 ENGINE TECHNICAL DESCRIPTION

The T56-A-427 Series IV engine is a modernized, improved version of the T56 Series III engine. The engine was developed to solve operational problems associated with the E-2C Hawkeye growth weight. The Navy needed an engine that would maintain a positive single engine rate of climb with the landing gear down, flaps at 20 degrees (take-off configuration for this aircraft), and a take-off gross weight of 54,000 pounds on a hot day with an engine operating at 95% efficiency. The solution to this problem was the T56-A-427 engine.[Ref. 10] The engine consists of one gas turbine power unit driving a single propeller shaft through a reduction gear

assembly. The power section of the engine is connected to the reduction gear assembly by way of an extension shaft formally called the torquemeter. The reduction gear assembly has a single propeller output shaft which is offset above the power section centerline. The reduction gear assembly causes a speed reduction of 12.87:1 which translates the rated power section speed of 14,239 RPM to a propeller speed of 1106 RPM. [Ref. 11]

The power section consists of the compressor section, combustion section, turbine section, and the accessories drive housing. The combustion section has six combustion chambers of the flow-through type assembled within a single annular combustion chamber located axially between a fourteen-stage, air-cooled, turbine assembly.

During operation, air enters the power unit through the compressor inlet housing and enters the 14 stage compressor. The compressed air flows through the diffuser to the combustion chamber where fuel is introduced, mixed with air and burned. The hot air gases exit through the turbine vanes and on to the turbine blades where the hot gases cause rotation of the turbine rotor. From that point the turbine rotor drives the compressor and the reduction gear assembly.

Engine operation is controlled by coordinated operation of the engine and the propeller control system. A characteristic of the T56 engine is that changes in power by the pilot are not related to a change in engine speed, but to a change in

turbine inlet temperature. During flight operations, the engine maintains a constant speed. This speed is known as the 100% rated speed of the engine and is the design speed at which the most power and best overall efficiency can be obtained. [Ref. 11] Power changes can be affected by changing the fuel flow. An increase in fuel flow causes an increase in the turbine inlet temperature and a corresponding increase in the energy available at the turbine. The turbine will then take this increase in energy and translate it to torque to the propeller. The propeller reacts to the increase in torque with an increase in rotation speed. With the increase in the speed of the propeller, the propeller control system will increase the blade angle of the propeller, thus producing more power to fly, and at the same time maintaining a constant engine RPM.

The fuel control system modulates fuel flow to match a horsepower schedule that varies linearly with the power lever placement. To achieve this horsepower schedule, a Digital Electronic Control (DEC) will vary the fuel flow that is needed by a hydromechanical fuel control. The DEC acts as a supervisory control with the primary operating mode of controlling horsepower. In addition to scheduling horsepower, the DEC controls the Turbine Measured Temperature (TMT) by limiting fuel flow during all engine operating conditions, this meaning that engine control is critical to the turbine measured temperature sent to the DEC. TMT is the average temperature taken off of the engine's fourteen single element

thermocouples located in the third stage of the turbine vanes.

Of major importance to this thesis, these fourteen thermocouples are wired in parallel and dispersed about the engine centerline. The thermocouples provide an average indication of the hot gas temperature within the turbine. The thermocouple output signal, as mentioned above, is referred to as TMT and is the primary controlling input used by the DEC for controlling engine power changes. The thermocouples' input signal is also sent to the DEC which provides the input signal to the TMT indicator in the cockpit. The TMT indicator is one of the pilot's primary engine monitoring instruments.

This thesis will concentrate on a recent problem with obtaining accurate information from the thermocouples that has developed on the T56-A-427 engine since its introduction into the fleet. More specifically, this study will investigate the unscheduled and scheduled maintenance actions on the interconnector harness end and mating thermocouple end connector at the firewall shown in Figure 3.1. on the next page.

B. COMPONENT IMPROVEMENT PROGRAM FUNDING FOR THE T56 ENGINE

The Navy's CIP is given its policies, guidelines and responsibilities for administration through NAVAIR Instruction 5200.35. [Ref. 1] According to the instruction, the Navy developed the CIP program in the early 1950's to enhance readiness and reduce life cycle costs for its aircraft

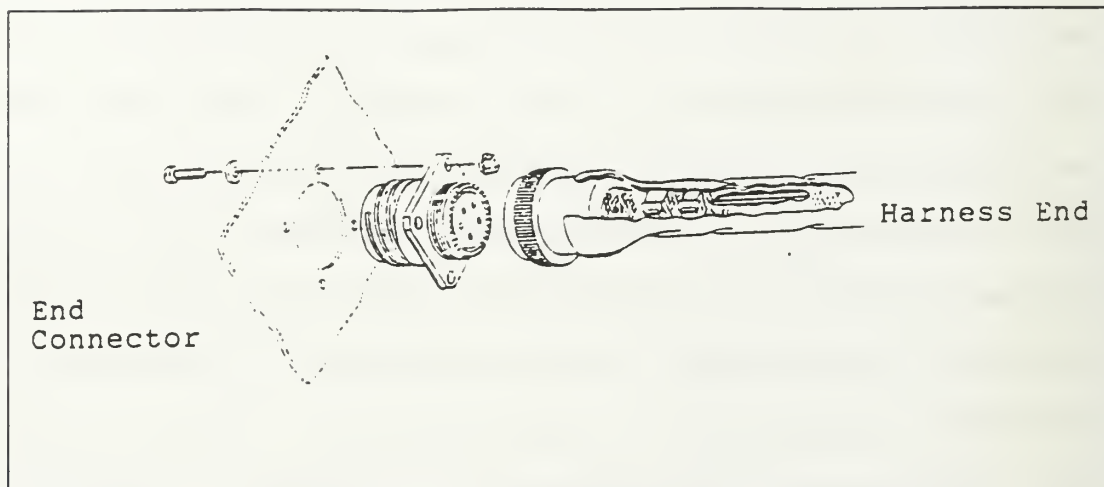


Figure 3.1. Thermocouple Interconnector Harness End and Mating Thermocouple End Connector.

propulsion systems. The instruction delineates the overall policy and responsibilities associated with the administration and management of the CIP for aircraft propulsion systems and related hardware. The instruction lists the three objectives of CIP to be:

1. Maintain an engine design which allows the maximum aircraft availability at the lowest cost to the government (primarily production and support cost);
2. Correct as rapidly as possible, any design inadequacy which adversely affects safety of flight;
3. Correct any design inadequacy which causes unsatisfactory engine operation or adversely affects maintainability and logistic support in service.

The primary function of the CIP program is to solve safety of flight problems that evolve with the aircraft after there has been government acceptance of the first procurement-funded aircraft. The second function of the CIP program is problem avoidance. Early detection of deficiencies in engines and engine components is the strategy of CIP to minimize

service problems and to extend service life.

To support the reason for this thesis and the past research done to validate the CIP, Figure 3.2. below displays how the funding for Navy CIP has become more constrained over the past fourteen years. The CIP has been funded at \$63,570,000 for FY94. [Ref. 12] The scope of this RDT&E appropriation encompasses thirteen engines and four different propellers.

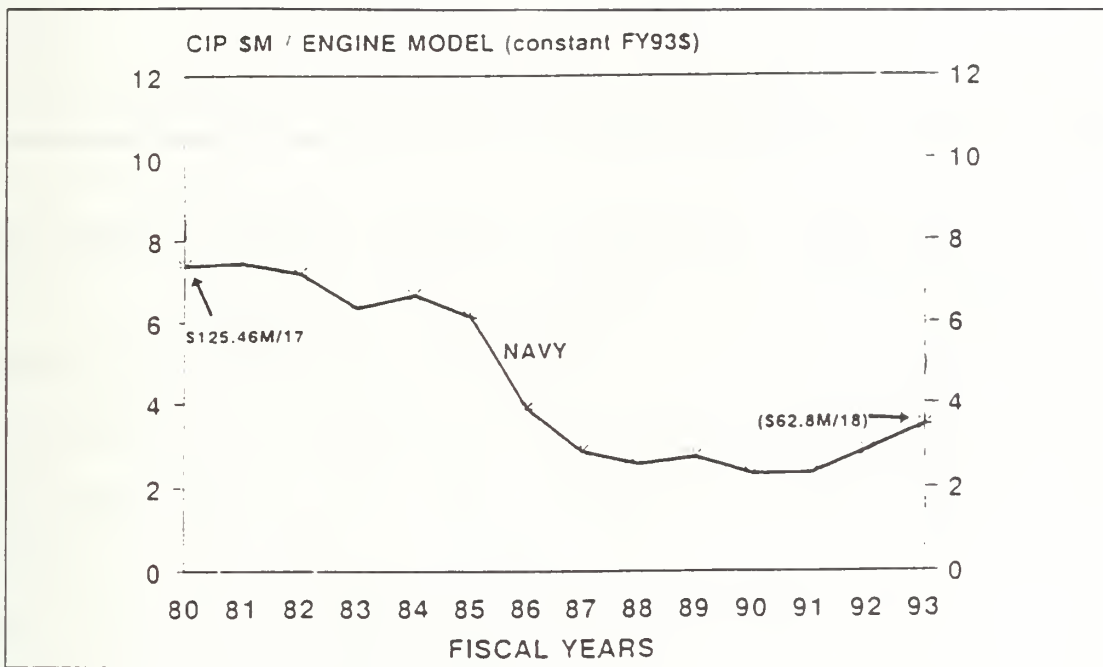


Figure 3.2. Navy CIP Funding.

Because the CIP is a Joint Service program, which includes Foreign Military Sales (FMS) and commercial participation, a network of eight contractors and eight different field activities are used by the Navy to support the CIP. [Ref. 12]

Table 3.1 on the next page is the T56 Engine CIP funding for the past three fiscal years. [Ref 11] What must be noted

here is that this funding is for the entire inventory of the Navy's T56 engines. Unfortunately, the author could not determine the breakdown of T56 CIP funding into the different series of T56 engines.

Table 3.1. NAVY T56 ENGINE CIP FUNDING.

ENGINE MODEL	AIRCRAFT	FY(92) \$(000)	FY(93) \$(000)	FY(94) \$(000)
T56	P-3, C-130, E-2C, C-2A(R)	1648	3020	2976

**C. THE COMPONENT IMPROVEMENT PROGRAM FUNDING PROCESS TO
CREATE POWER PLANTS CHANGE 111**

As outlined in Chapter II, there are the eight steps involved in the process of making a ECP into an installed PPC. [Ref. 9] The steps described by Jones and the dates that are of importance to the CIP effort chosen to be validated by this author; namely, PPC 111 (the methodology for studying this power plant change will be discussed later in this chapter), began with step one when Allison Gas Turbine Division General Motors Corporation submitting ECP 2103 to AIR-536 on 17 September 1991. [Ref. 13] Shortly after that date, steps two and three were completed when AIR-536 convened a Change Proposal Evaluation and Planning Conference with representatives from AIR-04, AIR-05, and PMA-231. PMA-231 is

the E-2C Hawkeye/C-2A(R) Greyhound Program Manager for Acquisition. Step four of the CIP process for ECP 2103 was completed on 25 November 1991. This step involved the issuing of the decision memorandum by AIR-536 since the planning conference representatives from step three recommended that ECP 2103 be processed.

Following the distribution of the decision memorandum to the various NAVAIR codes, AIR-536 initiated step five by requesting that the appropriate offices complete the Change Control Board Package prior to the target date of 19 December 1991 for the CCCB meeting. [Ref 13] Between the date the decision memorandum was routed and the scheduled date of the CCCB meeting, ECP 2103 was administratively processed through the appropriate NAVAIR codes noted on the decision memorandum so that they could complete the appropriate staffing actions required prior to the CCCB meeting. During this routing process, each office estimates the costs and determines the funding sources required to implement the ECP if it is approved by the CCCB. A major document within the ECP package is the standard NAVAIR Form 13050/2. This form is used as a signature page prior to the CCCB meeting for the appropriate codes to show that they are in agreement with the accounting data for the various labor costs and material items required to implement the ECP. Appendix A provides a copy of the Form 13050/2 which was used in the processing of ECP 2103.

Processing time for the ECP 2103 package ran from 10 December 1991, past the target date of the CCCB meeting to 23 March 1991. Jones' steps six and seven include this administrative process of acquiring the appropriate signatures before the board convenes. The final step in the funding process was step eight, which is the convening of the CCCB. ECP 2103 was presented to the board on 26 March 1991 by Mr. Dan Peckham, E-2C Propulsion Team Leader for AIR-536. The ECP was approved for funding and at that time formally becomes PPC 111.

D. DETERMINING A CANDIDATE FOR STUDY

Before choosing a power plant change to examine, the author talked with Mr. Rich Vernon and Mr. Chuck Hagewood, two T56 engine logistics managers assigned to the T56 Cognizant Field Activity (CFA), also known as the T56 Engine Depot, located at Naval Air Station Alameda. The author made two trips and spent several hours in discussion with these two logistics managers in the process of determining the feasibility of tracking a CIP effort on a T56 engine. Through these discussions, and an examination of the available administrative documents at the CFA, a recent power plant change on the T56 engine was chosen to begin the research process. This power plant change was PPC 99 which was a product of ECP 2059R3 originating from the Allison Gas Turbine Division for the 425 series of T56 engines. [Ref. 14]. This

PPC was of particular interest because of the need for the power plant change which is stated on the front of the ECP under the "need for change" description.

Navy E2-C aircraft operated by the U.S. Navy have experienced bogdown with the engine. Bogdown is defined as an unsolicited drop in engine speed that may be accompanied by compressor surge and or low speed stagnation. Bogdown is a result of a rapid throttle change where the fuel flow change is rapid and precedes propeller blade angle pitch change. Analysis, engine and flight testing have indicated bogdown can be prevented by the addition of a fuel accumulator in the engine fuel system. A check valve system has been incorporated in series with the accumulator to eliminate excessive power oscillations.

Focusing on this ECP, Mr. Hagewood and the author examined the various ECA reports which can be obtained from the NALDA system. It was hoped that these reports would provide records of historical maintenance deficiencies which might have been used to initiate the CIP process to correct the T56 bogdown problem. However, after several data runs to look at different ECA reports, it was discovered that no relevant data was available. Further discussion with Mr. Hagewood and another T56 logistic manager at the CFA, Mr. Allen Follett, provided the explanation for why the database produced no information on bogdown. Problems concerning bogdown on the T56 were not documented by fleet maintenance personnel in a standardize fashion. The bogdown problems were documented under different categories of maintenance malfunctions. For example, some bogdowns were documented as "compressor surges", while other bogdowns were documented as "engine RPM fluctuation indications". This caused

inconsistencies in the reporting data. The reason for this is that bogdown is not listed as a malfunction in the Work Unit Code Technical Manual for E-2C aircraft. [Ref. 15] This malfunction code manual is used by the fleet maintenance personnel for describing maintenance malfunctions on the Visual Information Display/Maintenance Action Form, commonly referred to as the VIDS/MAF, which is the form used for providing maintenance information to the NALDA system.

More importantly, the data system could not be accessed by a particular part number associated with the bogdown malfunction. In the case of PPC 99, parts were added to the engine to alleviate the bogdown malfunction. In contrast, Mr. Hagewood stressed that in order to trace the historical maintenance data on a particular component or part that had been involved with a CIP effort, the PPC would have to modify or change the component or part when the PPC is implemented. The reason for this is that, by implementing the PPC, the part number of the component will change because the PPC directive had been incorporated. This would give the researcher the ability to trace maintenance actions associated with both the old and the new part numbers.

Because of the knowledge gained from this discussion with Mr. Hagewood, the author and Mr. Follett began a search for another, perhaps more detailed, PPC that would be more easily traced using the NALDA system. Using the CFA's most current ECIFR [Ref. 16], the author examined the broad-based

nomenclature of component assemblies that were being tracked by the ECIFR as causes for "not mission capable for maintenance" times being recorded on the T56 engine. The author discovered that there was only a small number of component assemblies documented against the T56-A-427 engine. Further discussion about this observation with Mr. Follett revealed the fact that the 427 series T56 was the newest series of T56 engines used by the fleet. Mr. Follett explained the differences in the 427 series compared to the earlier series of T56 engines and he also explained that a E-2C Fleet Introduction Team (FIT) was located at NAS Miramar. The purpose of this team will be discussed later in this chapter.

Again the author reviewed the files at the CFA, but this time the review was targeted at finding a power plant change pertaining to the 427 series of engine. The review proved fruitful; PPC 111, which pertained only to the 427 engine, was found. In examining PPC 111 [Ref. 17], the author discovered that it fit the criteria of recommendations made by Sodol and Price [Ref.4] that it should be based on "maintenance driver." It was also a desirable component to examine based on the recommendations of prior CIP researchers Butler, Gordon, and Jones because it was at the component level. Finally, PPC 111 was a prime candidate to study because it could be tracked in the NALDA system.

E. THE METHODOLOGY FOR COLLECTING MAINTENANCE DATA FOR PPC

111

In developing a methodology to study PPC 111, initial research was directed at establishing a maintenance data source and finding knowledgeable individuals who could aid in the interpretation of the maintenance data. The author discovered that one of the purposes of the E-2C FIT, mentioned above, was to monitor and assist the fleet E-2C (plus) operating units with problems associated with the introduction of the T56-A-427 engine into the fleet. [Ref. 18] Further inquiries of FIT team members led the author to Chief Petty Officer Aviation Machinist (ADC) Debert Valle, the FIT T56 engine manager. ADC Valle enlightened the author as to why PPC 111 was important and how the changes in components associated with it were improving the engine. He also said that the PPC has been totally incorporated into the fleet.

When he visited the FIT, the author was given the liberty to investigate the files in an effort to obtain a working knowledge about PPC 111. These files revealed a log of Hazardous Material Reports (HMR) that had been initiated by the fleet squadrons pertaining to hazardous flying conditions related to maintenance malfunction problems. It was found that the T56-A-427 engine had a faulty TMT signal being sent to the engine fuel controlling unit. Valuable insight was gained by examining the collected HMRs on how the fleet squadron maintenance personnel were documenting this problem

and, more importantly, which part or parts they concluded were the cause of the problem. Jones [Ref. 9] described the use of the HMR as another form of documentation used by the various NAVAIR codes in monitoring any trend in deficiencies. When he mentioned this to ADC Valle, the author learned that the HMRS were being used by the FIT to force a faster retrofit of PPC 111. [Ref. 19]

From the HMRS the author was able to obtain maintenance data about the thermocouple problem that he considered germane to this thesis. By interpreting the entries on the HMRS using the cookbook style directions for filing a HMR report from Chapter Five of OPNAVINST 4790.2E [Ref. 20], the author was able to identify three part numbers found by the fleet maintainers to be the faulty items responsible for the TMT problems associated with the thermocouple harness assembly. These part numbers and their associated nomenclature are:

23032692 - Thermocouple Harness Assembly;

23030745 - Connector Assembly Plug;

23038786 - Harness Assembly Interconnecting Wiring.

Further investigation revealed that several different work unit code numbers were also used to identify the thermocouple system or sub-system on the HMRS. A work unit code number is used to identify the system or subsystem on which maintenance is performed. Unfortunately, on several HMR reports, this entry was left blank. This variance in documenting the correct system or sub-system on the engine was caused by the different

interpretations of the Work Unit Code Manual [Ref. 15] by the maintenance personnel documenting the discrepancy on the VIDS/MAF. [Ref. 21] The predominant work unit codes and their associated nomenclature are:

29E1M20 - Power Plant Cable Assembly;

223D370 - Turbine Thermocouple Harness Assembly.

Knowing these part numbers and work unit code numbers, the author had to next determine a method of extracting maintenance data from the NALDA system which could be used to calculate total maintenance manhours spent on correcting failures of the three parts listed above. The three part numbers were used because two of the part numbers (23038786 and 23032692) are cited in PPC 111 as being the parts which need to be replaced, and the third part number 23030745, the connector assembly plug, which is the end connector on the harness end (see Fig. 3.1). [Ref. 22]

In order to complete this task, the author, with the help of the FIT Maintenance Administrative Manager, Chief Petty Officer Aviation Administration (AZC) Fred Beierly, first ran a ECA Report 518. This report is a ranking program that is a work unit code to part number cross reference ranking report that displays all removed item/installed item part numbers associated with each work unit code. To search for the part numbers in the report, work unit codes 223D370 and 29E1M20 were used, and a report period was selected from January 1989 to December 1994. The report produced thirteen different part

numbers that had been documented against the search sequence work unit codes for that time frame, and the number of occurrences each of part number, under the two work unit code, had been entered into the system during the requested time span. As expected, the two part numbers of interest to this thesis were displayed in the report. To eliminate the part numbers which were not of interest, a different ECA report was run; namely, ECA Report 519. This report is a similar ranking report to 518 report, but it is a part number to work unit code cross reference ranking report which lists all work unit codes associated with each search sequence part numbers. The report was generated using part numbers 23030745 and 23038786 for the period from January 1989 to December 1993.

The 519 report produced ten different work unit codes that were in the ECA database that could be matched against the part numbers of interest. These work unit codes and their associated nomenclature are:

- 2230000 - T56 Turboprop Engine;
- 91D1300 - Parachute Riser Assembly;
- 223D380 - P/S Interconnecting Wire Harness;
- 4281100 - Power Plant Controls Aircraft Wiring;
- 29E1M00 - Turbine Inlet Temperature Indicating INS;
- 29E1L70 - Wiring Installation/Assemblies;
- 4281000 - Wiring Installations;
- 29E1M20 - Cable Assemblies; and
- 1435C00 - Unlisted.

The information produced on the 518 and 519 reports allowed the author to see the cross reference between the part numbers in question and the work unit code numbers used by maintenance personnel.

With the end goal in mind of determining the amount of maintenance manhours that were expended on the part numbers in question before PPC 111 was made, the author then turned to the ECA report 530. This report is a detailed description of the results of particular maintenance actions. The description includes qualitative information on "when discovered" codes, "action taken" codes and "malfunction description" codes. It also includes detailed equipment descriptions including type, model and series of aircraft, aircraft bureau number, work unit code, part number and serial numbers. Finally, the report includes a detailed maintenance action record that includes the failed part number and maintenance manhour/elapsed maintenance time data associated with the documented job code number of each entry. The job code number is used by squadrons and maintenance facilities to keep track of jobs.

The author was then able to merge the 530 report with the data produced from the 518 and 519 reports for the time period from January 1989 to December 1993. The resulting data produced by this aggregated report took over three hours to print at the NALDA terminal. However, the 530 report produced exactly the kind of information the author needed to tally the

number of manhours documented for fixing the parts in question over the time period of interest.

With this printout, the author then had to extract by hand the events and associated maintenance manhours recorded for the part numbers in question. The maintenance malfunction description codes used to identify the maintenance events which should be included in determining the manhours are listed below:

- 020 - worn, stripped or frayed;
- 070 - broken, burst, ruptured, punctured, torn cut;
- 160 - broken wire defective contact or connector;
- 374 - internal failure;
- 450 - open;
- 615 - shorted including internal.

These were determined to be appropriate based on the author's reading of the HMR reports and discussing of the PPC problem with the FIT team power plant office members.

The next step was to sum the annual maintenance manhours expended on the part numbers in question. This was extremely time-consuming because of the size of the printout.

F. VALIDATION OF THE METHODOLOGY FOR MAINTENANCE DATA COLLECTION

While visiting AIR-536 shortly after the research trip to NAS Miramar, the author realized that he had mistakenly left part number 23032692 out of his data collection from the ECA

530 report. With this in mind, and the fact that he had not completed the summation of the maintenance manhours, the author sought help from the Propulsion Team Leader, Mr. Dan Peckham. Mr. Peckham was able to arrange a meeting between the author and Mr. Chuck Orwig, AIR-71334. Mr. Orwig is the program manager who is responsible for producing the ECIFR. Mr. Orwig introduced the author to Mr. Bob Weaver of the SYS Company, located in Crystal City, Virginia. SYS is the company that physically produces the information printouts for the ECIFR for AIR-71334 [Ref. 23]. Mr. Weaver is the principal information systems operator that produces the ECIFR, and is SYS's point of contact with AIR-71334.

The author and Mr. Weaver went over the printouts 518, 519 and 530. The author explained his main goal, which was to collect maintenance manhour data pertaining to PPC 111, and the specific methodology he was using in collecting the data out of the ECA reports. Mr. Weaver totally agreed with this methodology and stated that it was the correct way to attack the problem with the quality and length of the 530 report that the author had. However, Mr. Weaver explained that he could produce a better quality ECA 530 report with a set of in-house COBOL programs developed by SYS. The forte of these COBOL programs is that they are able to condense large amounts of data into a more user-friendly printout. Mr. Weaver agreed on the author's data merging strategy for the problem at hand. He then made a photocopy of the front page of the author's 530

report to ensure that he had the right input part numbers and work unit codes. The author received Mr. Weaver's printouts on all three part numbers a very short time after their meeting by way of FAX. These printouts proved to be just what the author needed to complete his data collection. A summary of the O-level and I-level maintenance manhours for 1990-1993 is shown in Table 3.2. below. Appendix B is a copy of the ECA 530 report produced by Mr. Weaver.

Table 3.2. TOTAL MAINTENANCE MANHOUR AND EVENTS SUMMARY.

YEAR	Total O-Level Manhours	Total I-Level Manhours	Total O-Level Maint Events	Total I-Level Maint Events
1990	220.9	0.0	2	0
1991	165.2	0.0	5	0
1992	73.8	3.0	6	2
1993	324.5	52.2	24	4

G. OTHER MAINTENANCE MANHOURS ASSOCIATED WITH PPC 111

Research of the HMRS indicated that squadron commanding officers of E-2C (plus) squadrons were concerned that the length of time required by the ECP/PPC process would be unacceptably long. They wanted an immediate solution to the problem associated with the interconnector harness end and mating thermocouple end connector. For this reason, the

squadrons, with the assistance of the FIT team, recommended that the thermocouple harness connector cannon plug (part Number 23023745) be cleaned and treated every 14 days instead of the already established 28 days. This recommendation was approved by NADEP North Island, which was the E-2C CFA, in June of 1991. [Ref.24]

The author decided that the added number of expended manhours consumed in performing the cleaning of the cannon plug should be included in the total maintenance manhours associated with the PPC 111 because the procedure involved cleaning the parts that PPC 111 was going to fix. To calculate the yearly manhours used to perform this inspection and cleaning, the following reasoning was used. The actual procedure takes on average 0.5 manhours. [Ref. 25] The 28-day inspection is done on the average 13 times a calendar year on one aircraft. Reducing the time between inspections to 14 days increases the number of cleanings of the cannon plug to 26 times a year. Thus, for each aircraft, 13 times .05 manhours or 6.5 extra manhours would be expended per year. To calculate the total yearly sum of O-level maintenance manhours expended would be the product of 6.5 and the total number of aircraft in operation during the time period from 1 June 1991 to 31 March 1994. March 31, 1994 is used as a ending date due to the fact that all squadrons had the PPC incorporated on their aircraft by this date, and the practice of the 14-day inspection was returned to the 28 day cycle.[Ref. 25] The

annual total number of E-2C (plus) aircraft in operation during this time period was obtained from an aircraft status summary report provided by the FIT team.[Ref. 26] The increase in O-level maintenance manhours and maintenance events per year is displayed in Table 3.3. below. This procedure only involved O-level maintenance and did not require any I-level maintenance.

Table 3.3. ADDITIONAL MAINTENANCE MANHOURS AND EVENTS SUMMARY.

Year	Total Number of Aircraft	Total O-Level Manhours	Total O-Level Maint Events
1991	22	71.5 (1/2 year)	143
1992	29	188.5	377
1993	34	221	442
1994	39	126.5 (1/4 year)	253

H. NO MAINTENANCE MANHOURS TO INSTALL PPC 111

During his research, the author discovered that no actual O-level maintenance manhours were expended on the installation of PPC 111. The reason is that one Allison Field Representative, Mr. Richard Williams, performed all of the PPC installations at a rate of approximately four hours per aircraft.[Ref. 27] This issue was discussed with the Allison

Engineering Customer Service Representative, Mr. Tom Ryan, at the Allison plant in Indianapolis, IN. He explained to the author that Mr. Williams was paid out of the Allison Production Support Funds, and that no extra Navy funds (CIP, OM&N or APN) were used to install PPC 111. [Ref. 28] The author also addressed this issue with Mr. Peckham at AIR-536. According to him the installation of PPC 111 was considered a "Free-Bee" by the Navy. For these two reasons, the author elected not to include any Navy maintenance manhours for installation in his calculations.

IV. PRESENTATION OF BEFORE-AND-AFTER LIFE CYCLE COSTS

A. BACKGROUND

This chapter presents the life cycle financial data associated with the T56-A-427 interconnector harness end and the mating thermocouple end connector before and after the incorporation of PPC 111. The results will be used in the cost-benefit analysis in Chapter V. Two life cycle cost models will be presented. The first model shows the actual and estimated costs of the E-2C (plus) fleet of aircraft as if PPC 111 was not incorporated. The second model displays the actual and estimated cost of the E-2C (plus) fleet of aircraft with the PPC 111 change incorporated. The author assumed that the T56-A-427 engine would have a useful operational life through year 2005, since no new tactical Navy aircraft are expected until that year.[Ref. 2]

The financial cost data included in this chapter is:

1. Research and Development (R&D), or CIP costs required to generate the PPC 111. This information comes from the first page of the finalized EPD No. 5647.1.07RA, [Ref. 29] which was produced by Allison and provides detailed information on the PPC. The EPD also records decisions made at the contractor's CIP conferences and the progress of the CIP research and development. After the "fix" has been designed and a PPC has been issued to the fleet, a final version of the EPD is published with the total historical CIP R&D costs required to identify and engineer the "fix." [Ref. 30]
2. Navy (APN) investment costs to purchase the PPC 111 modification kits and other APN funds that were included with the approval of ECP 2103. These other costs were the

cost of printing the technical directives, obsolescent equipment costs, reworked equipment costs, and the cost of test equipment. Also included is the cost to change the existing E-2C (plus) procurement contract to incorporate the ECP on aircraft still on the production line. This cost information comes from the Cost and Funding and Milestones Charts in the CCCB package. (Appendix A)

3. All known and estimated maintenance costs associated with the maintenance actions or events at the O and I levels of maintenance that were presented in Chapter III.

The financial cost data does not include any transportation costs to ship the modification kits to NAS Miramar since this information could not be found. Also, the author determined that there would not be any way to determine inventory carrying costs pertaining to the modification kits because the kits were sent directly to the FIT facility instead of Navy's supply system. The kits were held then at the FIT facility until the Allison field representative could install the kits on the aircraft. [Ref. 19] No material costs for consumable maintenance materials, such as electrical wiring, safety wire and cleaning fluids were included in the analysis, because these materials were not kept track of by the maintenance personnel for each particular job. [Ref. 19]

The historical (1990 to 1993) and projected (1994 to 2005) costs are presented in "then year" dollars to aid in the analysis to be done in Chapter V.

B. ACTUAL COSTS OF THE R&D AND APN INVESTMENTS ASSOCIATED WITH PPC 111

The CIP R&D costs to design the new interconnector harness

end and thermocouple end connector, and the APN procurement costs to purchase the modification kits and pay for various other procurement costs noted above are presented in Appendix A. The actual R&D or CIP investment costs of \$80,000 were paid out in the year of 1990 which is the year that Allison did research and development work on this CIP effort. The APN investment costs required to pay for the modification kits totaled \$67,666. A total of 78 kits, at a cost of \$867.51 each, were purchased in 1992 as shown on the Cost and Funding Milestones Chart (Appendix A).

Other costs were also incurred in 1992. They are shown on the second page of Appendix A. The cost to reproduce the technical publications to implement PPC 111 totaled \$450. The cost of the obsolete equipment that Allison charged to the Navy, because of PPC 111, amounted to \$10,317. The type of equipment this money paid for was not documented by NAVAIR. [Ref. 31] The cost Allison charged to rework old equipment and to facilitate the new design required by PPC 111 was \$10,560. This type of equipment was not documented by NAVAIR either. [Ref. 31] Test equipment used by Allison in the R&D process totaled \$1,500. The cost to add PPC 111 to Navy E-2C (plus) aircraft engines still on the production line during April of 1992 was \$13,549. [Ref. 32] The total of the kit costs and these other costs was \$104,042.

These R&D and APN "then year" costs will be used later in this chapter when the author presents the after or modified

(PPC 111 incorporated) life cycle costs for the E-2C (plus) fleet in Table 4.2.

C. LABOR RATES FOR "O" LEVEL AND "I" LEVEL MAINTENANCE

Labor costs at an hourly rate for O and I levels of maintenance for the T56-A-427 engine were acquired by the author from the VAMOSC database. [Ref. 33] The labor rates acquired were for each of the past years up to and including the year 1993. For the labor rates beyond that year, the author estimated the labor rate using a 6.1% increase which was the average increase over the last four years. This method was also used by Jones. [Ref. 9] The labor rates are used to calculate the maintenance labor costs at the O-level and I-level that were expended and are estimated to be expended because of failures pertaining to the component. These values are shown in Tables 4.1. and 4.2. in the process of determining the annual maintenance labor costs.

D. CURRENT CONFIGURATION TOTAL ANNUAL LIFE CYCLE COSTS (PPC 111 NOT INCORPORATED)

Table 4.1. on the next page provides the actual and estimated life cycle costs for the E-2C (plus) fleet of aircraft as if PPC 111 was not incorporated. All costs are shown in "then-year" dollars.

Column 1 presents the annual total number of unscheduled maintenance actions at the O-level involving the

Table 4.1. CURRENT CONFIGURATION TOTAL ANNUAL LIFE CYCLE COSTS

YEAR	COL1 UNSCH EVENTS O-LEVEL MAINTENANCE	COL 2 UNSCH EVENTS I-LEVEL MAINTENANCE	COL 3 SCHEDULED EVENTS O-LEVEL	COL 4 UNSCH MAINTENANCE MAN HOURS O-LEVEL	COL 5 UNSCH MAINTENANCE MANHOURS I-LEVEL	COL 6 SCHEDULED MAINTENANCE MANHOURS O-LEVEL COL3X.5MMH/EVENT	COL 7 TOTAL O-LEVEL MAINTENANCE MANHOURS COL(4+6)
1990	2	0	156	220.9	0.00	78.00	298.90
1991	5	0	429	165.2	0.00	214.50	379.70
1992	6	2	754	73.8	3.00	377.00	450.80
1993	24	4	884	324.5	52.20	442.00	766.50
1994	48	5	1014	648	65.25	507.00	1,155.00
1995	96	5	1014	1296	65.25	507.00	1,803.00
1996	192	5	1014	2592	65.25	507.00	3,099.00
1997	312	5	1014	4212	65.25	507.00	4,719.00
1998	312	5	1014	4212	65.25	507.00	4,719.00
1999	312	5	1014	4212	65.25	507.00	4,719.00
2000	312	5	1014	4212	65.25	507.00	4,719.00
2001	312	5	1014	4212	65.25	507.00	4,719.00
2002	312	5	1014	4212	65.25	507.00	4,719.00
2003	312	5	1014	4212	65.25	507.00	4,719.00
2004	312	5	1014	4212	65.25	507.00	4,719.00
2005	312	5	1014	4212	65.25	507.00	4,719.00

COL 8 TOTAL I-LEVEL MAINT MANHOURS COL 5	COL 9 O-LEVEL MMH LABOR COST/HOUR	COL 10 I-LEVEL MMH LABOR COST/HOUR	COL 11 TOTAL O-LEVEL MAINT LABOR COST COL 7 X COL 9	COL 12 TOTAL I-LEVEL MAINT LABOR COST COL 8 X COL 10	COL 13 TOTAL COST MAINT LABOR (THEN YEAR) COL(11 +12)
0	\$14.18	\$17.03	\$4,238.40	\$0.00	\$4,238.40
0	\$15.28	\$18.35	\$5,801.82	\$0.00	\$5,801.82
3.00	\$16.45	\$19.76	\$7,415.66	\$59.28	\$7,474.94
52.2	\$17.08	\$20.51	\$13,091.82	\$1,070.62	\$14,162.44
65.25	\$18.12	\$21.74	\$20,928.60	\$1,418.54	\$22,347.14
65.25	\$19.22	\$23.06	\$34,653.66	\$1,504.67	\$36,158.33
65.25	\$20.39	\$24.47	\$63,188.61	\$1,596.67	\$64,785.28
65.25	\$21.63	\$25.96	\$102,071.97	\$1,693.89	\$103,765.86
65.25	\$22.94	\$27.54	\$108,253.86	\$1,796.99	\$110,050.85
65.25	\$24.33	\$29.21	\$114,813.27	\$1,905.95	\$116,719.22
65.25	\$25.81	\$30.99	\$121,797.39	\$2,022.10	\$123,819.49
65.25	\$27.38	\$32.88	\$129,206.22	\$2,145.42	\$131,351.64
65.25	\$29.05	\$34.89	\$137,086.95	\$2,276.57	\$139,363.52
65.25	\$30.82	\$37.01	\$145,439.58	\$2,414.90	\$147,854.48
65.25	\$32.70	\$39.27	\$154,311.30	\$2,562.37	\$156,873.67
65.25	\$34.69	\$41.66	\$163,702.11	\$2,718.32	\$166,420.43

interconnector harness end and mating thermocouple end connector. For the years 1990 to 1993, the actual number of maintenance actions that occurred are shown. To determine the number of maintenance events for the years 1994 to 2005, the author contacted the FIT team Engine Program Manager, ADC Valle. He told the author that from his experiences in monitoring the connector problem, an estimate of failures per aircraft per year would increase to four events within the next three years. [Ref. 34] To establish a second opinion on the number of maintenance events for these years, the author also contacted Mr. Dan Peckham, E-2C Propulsion Team Leader at AIR-536. Mr. Peckham strongly agreed with the expert opinion of the FIT Team Program Manager. [Ref. 35] To achieve the total number of maintenance events equal to four per aircraft by 1997, the author doubled the number of maintenance events from the previous year starting in 1994. Then for 1997, 39 times 4 or a total of 312 maintenance actions were assumed. From that year on, the number of maintenance events were assumed to remain constant at 312 until 2005.

Column 2 contains the annual number of I-level unscheduled events that occurred for the years 1990 to 1993. I-level maintenance events for the year 1994 to 2005 could not be estimated by the FIT Team Engine Program Manager because historical maintenance data showed that most failures were corrected at the O-level. For that reason, the author estimated that the I-level events would increase by one for

the year 1994 and then remain constant from that year on.

Column 3 presents the number of scheduled events at the O-level. These are the actual 28-day inspections (1 January 1990 to 1 June 1991) and the 14-day inspections (1 June 1991 to 31 December 2005) that would be expected to occur for the entire life cycle. The methodology for determining this number of scheduled events per year was discussed in Chapter III.

Column 4 shows the annual maintenance manhours expended at the O-level to perform the unscheduled maintenance on the faulty component. The actual maintenance manhours are displayed for the years 1990 to 1993. For the years 1994 to 2005, the author calculated the average number of maintenance manhours per event for the year 1993, 13.5 hours, and multiplied this by the total number of events in column 1. The author concluded that the average number of manhours per event for 1993 was a better estimate to use than the averages from preceding years because the maintenance personnel would become used to correcting the faulty component.

Column 5 contains the unscheduled maintenance manhours expended at the I-level. For the years 1990 to 1993, the actual numbers are shown. For 1994 and later, the author used the same reasoning as mentioned above for column 4. The average number of hours used 13.05. That value was then multiplied by the number of events in column 2.

Column 6 presents the total of maintenance manhours

expended to perform the scheduled inspections at the O-level. It is the product of column 3 and 0.5 maintenance manhours per event. The use of the 0.5 manhours was discussed in detail in Chapter III.

Column 7 contains the sum of columns 4 and 6. It provides the total amount of O-level manhours per year for scheduled and unscheduled events.

Column 8 contains the total I-level maintenance manhours per year. Because there was no scheduled I-level maintenance performed on the component, column 8 is the same as column 5.

Column 9 contains the "then-year" O-level maintenance manhour labor rate (cost) per hour. The source of this information and the calculation for the future years was discussed earlier in Section C of this chapter.

Column 10 contains the "then-year" I-level maintenance manhour labor rate. The same calculation that was done for O-level maintenance was done for I-level for future years.

Column 11 presents the "then-year" total O-level maintenance labor costs. It is the product of column 7, the total hours, and column 9, the labor rate per hour.

Column 12 presents the "then-year" total I-level maintenance labor costs. It is the product of column 8, the total hours, and column 10, the labor rate per hour.

Column 13 contains the sum of column 11 and column 12. It is the total cost in "then-year" dollars for maintenance on the interconnector harness end and thermocouple end connector.

The amounts in column 13 will be compared in Chapter V with similar costs associated with the modified or PPC 111 incorporated life cycle model to be presented next.

E. MODIFIED CONFIGURATION TOTAL ANNUAL LIFE CYCLE COSTS (PPC 111 INCORPORATED)

Table 4.2 on the next page presents the actual and estimated costs that have and are projected to occur with PPC 111 installed on the Navy's E-2C (plus) fleet of aircraft. The first 13 columns present the calculation of total annual maintenance labor costs. Maintenance events and manhours for the years 1990 to 1994 are the actual amounts. An estimate for the number of maintenance events and total manhours beyond 1994, was made which will be discussed later in this section. Column 14 contains the R&D costs and the procurement costs for the modification kits. This information was presented at the beginning of the chapter in Section B.

Column 1 contains the actual and predicted annual number of unscheduled O-level maintenance events. For the years 1990 to 1993, it is the same as column 1 of Table 4.1. For 1994, it is the total number of actual maintenance events after the PPC 111 incorporation (recall that all PPC 111 changes were made by March 1994). Further investigation by the author has revealed that both failures in 1994 occurred due to reasons attributed to the installation of the PPC 111 change. The failures occurred on two different aircraft assigned to two

**Table 4.2. MODIFIED CONFIGURATION (PPC 111 INCORPORATED)
TOTAL ANNUAL LIFE CYCLE COSTS**

YEAR	COL1 UNSCH EVENTS O-LEVEL MAINTENANCE	COL 2 UNSCH EVENTS I-LEVEL MAINTENANCE	COL 3 SCHEDULED EVENTS O-LEVEL	COL 4 UNSCH MAINTENANCE MAN HOURS O-LEVEL	COL 5 UNSCH MAINTENANCE MANHOURS I-LEVEL	COL 6 SCHEDULED MAINTENANCE MANHOURS O-LEVEL COL3 X 5MMH/EVENT	COL 7 TO O-LEVEL MAINTENANCE MANHOURS COL 4
1990	2	0	156	220.9	0.00	78.00	\$298
1991	5	0	429	165.2	0.00	214.50	\$375
1992	6	2	754	73.8	3.00	377.00	\$450
1993	24	4	834	324.5	52.20	442.00	\$766
1994	2	0	634	129.4	0.00	317.00	\$446
1995	1	0	507	13.5	0.00	253.50	\$267
1996	1	0	507	13.5	0.00	253.50	\$267
1997	1	0	507	13.5	0.00	253.50	\$267
1998	1	0	507	13.5	0.00	253.50	\$267
1999	1	0	507	13.5	0.00	253.50	\$267
2000	1	0	507	13.5	0.00	253.50	\$267
2001	1	0	507	13.5	0.00	253.50	\$267
2002	1	0	507	13.5	0.00	253.50	\$267
2003	1	0	507	13.5	0.00	253.50	\$267
2004	1	0	507	13.5	0.00	253.50	\$267
2005	1	0	507	13.5	0.00	253.50	\$267

COL 8 TOTAL I-LEVEL MAINT MANHOURS COL 5	COL 9 O-LEVEL MMH LABOR COST/HOUR	COL 10 I-LEVEL MMH LABOR COST/HOUR	COL 11 TOTAL O-LEVEL MAINT LABOR COST COL 7 X COL 9	COL 12 TOTAL I-LEVEL MAINT LABOR COST COL 9 X COL 10	COL 13 TOTAL COST MAINT LABOR (THEN YEAR) COL(11 + 12)	COL 14 INVESTMENT COST TOTALS SECTION B CHAPTER IV	COL 15 TOTAL LABOR AND INVESTMENT COST (THEN YEAR) COL(11 + 14)
0	\$14.18	\$17.03	\$4,238.40	\$0.00	\$4,238.40	\$80,000.00	\$84,238.40
0	\$15.28	\$18.35	\$5,801.82	\$0.00	\$5,801.82	0	\$5,801.82
3.00	\$16.45	\$19.76	\$7,415.66	\$59.28	\$7,474.94	\$104,042.00	\$111,516.94
52.2	\$17.08	\$20.51	\$13,091.82	\$1,070.62	14162.442	0	\$14,162.44
0	\$18.12	\$21.74	\$8,088.77	\$0.00	\$8,088.77	0	\$8,088.77
0	\$19.22	\$23.06	\$5,131.74	\$0.00	\$5,131.74	0	\$5,131.74
0	\$20.39	\$24.47	\$5,444.13	\$0.00	\$5,444.13	0	\$5,444.13
0	\$21.63	\$25.96	\$5,775.21	\$0.00	\$5,775.21	0	\$5,775.21
0	\$22.94	\$27.54	\$6,124.98	\$0.00	\$6,124.98	0	\$6,124.98
0	\$24.33	\$29.21	\$6,496.11	\$0.00	\$6,496.11	0	\$6,496.11
0	\$25.81	\$30.99	\$6,891.27	\$0.00	\$6,891.27	0	\$6,891.27
0	\$27.38	\$32.88	\$7,310.46	\$0.00	\$7,310.46	0	\$7,310.46
0	\$29.05	\$34.89	\$7,756.35	\$0.00	\$7,756.35	0	\$7,756.35
0	\$30.82	\$37.01	\$8,228.94	\$0.00	\$8,228.94	0	\$8,228.94
0	\$32.70	\$39.27	\$8,730.90	\$0.00	\$8,730.90	0	\$8,730.90
0	\$34.69	\$41.66	\$9,262.23	\$0.00	\$9,262.23	0	\$9,262.23

different squadrons, with both squadrons documenting a high amount of O-level maintenance manhours against the discrepancies. The author asked the FIT why there were so many manhours spent correcting these two problems. He learned that both squadrons' maintenance departments were under the assumption that the interconnector harness end and thermocouple end connector problem had been eliminated when PPC 111 was incorporated on the aircraft. Therefore, several hours were spent trouble-shooting the aircraft before the faulty component was discovered. [Ref. 36] In both cases, new components were supplied to the squadrons by the FIT where, as mentioned earlier, the modification kits were held. The faulty components were sent to Allison for investigation.

For the years 1995 and beyond, the author had to make a determination as to how many failures were expected to occur on the PPC 111 incorporated component. The Allison Engineering Program Description [Ref.29] listed the total number of failures with the "fix" incorporated as zero. For any explanation of this reasoning, the author sought the help of Mr. Gary Bergoine at Allison Gas Turbine Division General Motors Corporation, T56 Engineering Programs. Mr. Bergoine explained that Allison's program objective concerning the interconnector harness end and mating end connector was to design a "fix" that would eliminate all of the maintenance actions on the component. Allison terms this as reducing the failure rate from "reasonably probable" to "remote." Mr.

Bergoine explained that the meaning of "remote" to the Allison engineers is that the failure will never occur again. [Ref. 37] Mr. Bergoine also explained that the two PPC 111 incorporated component failures for 1994 were not considered failures of the component, but failures due to installation. However, Mr. Bergoine did think that a reasonable estimate of one failure per year would be, at most, the best probable estimate for considerations of life cycle modeling. For this reason, the author used one unscheduled maintenance event per year for the years 1995 and beyond.

Column 2 presents the total number of annual unscheduled maintenance events at the I-level. Like column 1, the years 1990 to 1993 are the same as in Table 4.1. For the years 1994 and later, the author concluded that no unscheduled maintenance actions would be expected to occur at the I-level. This is because the number of failures historically requiring I-level maintenance were so few that if only one failure per year were expected then I-level maintenance would probably not be involved with the corrective actions required.

Column 3 presents the total number of scheduled maintenance events at the O-level. The column reflects the same information as column 3 in Table 4.1. until 1994. As mentioned in Chapter III, the practice of the 14-day inspection was stopped by the end of March 1994 and the 28-day inspection was resumed. As mentioned in Chapter III, the number of scheduled events from 1995 to 2005 was the product

of 13 times per year per aircraft and the number of aircraft in the fleet that year.

Column 4 contains the annual total number of maintenance manhours expended or expected to be expended on correcting deficiencies of the component. For 1994 the author has included the actual manhours expended with the two failures mentioned above. For the years 1995 and later, the author used the same amount of manhours per maintenance event that was used for estimating future years in Table 4.1. The 13.5 hours per event is a more reasonable estimate considering that the squadrons will be expecting a failure and would know how to fix the failed component.

Column 5 contains the unscheduled maintenance manhours per event for I-level maintenance. For the years 1994 and beyond, the yearly amount of hours expended would be zero because there are expected to be no I-level unscheduled events (see column 2).

Column 6 presents the scheduled maintenance manhours expended per year. It is the product of column 3 and .5 maintenance manhours per event.

Column 7 presents the total number of maintenance manhours, both scheduled and unscheduled, at O-level maintenance. It is the sum of column 4 and column 5.

Column 8 contains the total I-level maintenance manhours. It is the same as column 5 since there are no scheduled maintenance actions at I-level.

Column 9 presents the O-level maintenance manhour labor (cost) rate. It is the same as column 9 in Table 4.1.

Column 10 is the I-level maintenance manhour labor (cost) rate. It is the same rate used in column 10 of Table 4.1.

Column 11 presents the total annual costs of O-level maintenance. It is the product of column 7 (the total number of hours) and column 9 (the rate per hour).

Column 12 presents the total annual costs of I-level maintenance. It is the product of column 9 and column 10.

Column 13 contains the total annual costs of maintenance labor. It is the sum of column 11 and column 12.

Column 14 presents the total R&D and APN investment costs for PPC 111 discussed in Section B of this chapter.

Column 15 presents the total annual costs for labor and investment. It is the sum of column 13 and column 14.

V. COMPARISON AND ANALYSIS OF THE TWO LIFE CYCLE MODELS

OMB Circular A-94 [Ref. 38] requires that investments made by federal agencies be analyzed using break-even and Net Present Value analyses.

A. BREAK-EVEN POINT ANALYSIS

A break-even analysis will give insight into when the savings or benefits from an investment are expected to be equal to or exceed the costs associated with making the investment. Hopefully, the break-even point will occur prior to the end of the equipment's useful life. In the case of the investment for PPC 111, this should be prior to the year 2005.

Table 5.1. presents the results of the break-even analysis. The first two columns present the total annual costs in "then year" dollars for the two life cycle models of Chapter IV. Column 1 was obtained from column 13 of Table 4.1. It shows the total annual expenditures expected to accrue assuming that PPC 111 was not incorporated. Column 2 is from column 15 of Table 4.2. It shows the total annual expenditures expected to accrue when PPC 111 is incorporated. Column 3 is the difference between column 1 and column 2, and represents the annual increase in costs (shown in parentheses) or the savings resulting from incorporating PPC 111. Column 4 contains the cumulative sum of the savings from column 3 and

Table 5.1. BREAK-EVEN ANALYSIS

	COL 1 EXPENDITURE CURRENT COL 13 TABLE 4.1	COL 2 EXPENDITURE MODIFIED COL 15 TABLE 4.2	COL 3 DELTA CASH FLOW YEARLY SAVINGS COL(1-2)	COL 4 CUMULATIVE SAVINGS COL 3 + COL 4 PREVIOUS YEAR
YEAR				
1990	\$4,238.40	\$84,238.40	(\$80,000.00)	(\$80,000.00)
1991	\$5,801.81	\$5,801.81	\$0.00	(\$80,000.00)
1992	\$7,474.94	\$111,516.94	(\$104,042.00)	(\$184,042.00)
1993	\$14,162.44	\$14,162.44	\$0.00	(\$184,042.00)
1994	\$22,347.14	\$8,088.76	\$14,258.38	(\$169,783.62)
1995	\$36,158.33	\$5,131.74	\$31,026.59	(\$138,757.03)
1996	\$64,785.28	\$5,444.13	\$59,341.15	(\$79,415.88)
1997	\$103,765.86	\$5,775.21	\$97,990.65	\$18,574.77
1998	\$110,050.85	\$6,124.98	\$103,925.87	\$122,500.64
1999	\$116,719.22	\$6,496.11	\$110,223.11	\$232,723.75
2000	\$123,819.49	\$6,891.27	\$116,928.22	\$349,651.97
2001	\$131,351.64	\$7,310.46	\$124,041.18	\$473,693.15
2002	\$139,363.52	\$7,756.35	\$131,607.17	\$605,300.32
2003	\$147,854.48	\$8,228.94	\$139,625.54	\$744,925.86
2004	\$156,873.67	\$8,730.90	\$148,142.77	\$893,068.63
2005	\$166,420.43	\$9,262.23	\$157,158.20	\$1,050,226.83

shows the break-even point of this analysis. The break-even point occurs when the sign of the cumulative sum changes from negative to positive. The earliest break-even point for PPC 111 occurs in the year 1997. This is considered to be the earliest possible break-even point for this investment because it does not consider the time value of money. If discounting

was used in this analysis, the break-even point would occur at a later point in time.

B. NET PRESENT VALUE ANALYSIS

Present Value is the value today of an amount of money in the future. For the purpose of this thesis, the Net Present Value for this CIP investment was calculated in FY94 constant dollars with a capital discount rate of 10%. This discount rate is the generally accepted rate used by the Department of Defense.

Table 5.2. presents the Net Present Value analysis. Columns 1 and 2 are the same as in Table 5.1. Column 3 contains the present value factor used for cash flows in the past and the discount factor for cash flows in the future. The present value factor is 1.10^n where n is the number of years into the past from 1994. The discount factor is used for all cash flows in the future. It is defined as $1/1.10^n$ where n is the number of years into the future from 1994. Column 4 contains the present value of the annual expenditures from the current configuration model. It is the product of column 1 and column 3 and represents the present worth of the annual cash flows. Column 5 shows the present value of the annual expenditures from the modified configuration model. It is the product of column 2 and column 3. The sum of the present value dollar amounts is displayed at the bottom of column 6 and column 7 and is the Net Present Value (NPV) of the each model.

Table 5.2. NET PRESENT VALUE ANALYSIS

YEAR	COL 1	COL 2	COL 3	COL 4	COL 5
	EXPENDITURE	EXPENDITURE	PRESENT	PV	PV
	CURRENT	MODIFIED	VALUE	EXPENDITURE	EXPENDITURE
	COL 13	COL 15	FACTOR	CURRENT	MODIFIED
	TABLE 4.1	TABLE 4.2	1990-1993 DISCOUNT FACTOR 1995-2005	COL 1 * COL 5	COL 2 * COL 5
1990	\$4,238.40	\$84,238.40	1.46	\$6,205.44	\$123,333.44
1991	\$5,801.81	\$5,801.81	1.33	\$7,722.21	\$7,722.21
1992	\$7,474.94	\$111,516.94	1.21	\$9,044.68	\$134,935.50
1993	\$14,162.44	\$14,162.44	1.10	\$15,578.68	\$15,578.68
1994	\$22,347.14	\$8,088.76	1.00	\$22,347.14	\$8,088.76
1995	\$36,158.33	\$5,131.74	0.91	\$32,871.18	\$4,665.21
1996	\$64,785.28	\$5,444.13	0.83	\$53,541.54	\$4,499.28
1997	\$103,765.86	\$5,775.21	0.75	\$77,960.47	\$4,338.98
1998	\$110,050.85	\$6,124.98	0.68	\$75,166.16	\$4,183.44
1999	\$116,719.22	\$6,496.11	0.62	\$72,473.41	\$4,033.57
2000	\$123,819.49	\$6,391.27	0.56	\$69,392.76	\$3,889.94
2001	\$131,351.64	\$7,310.46	0.51	\$67,404.14	\$3,751.42
2002	\$139,363.52	\$7,756.35	0.47	\$65,014.10	\$3,618.39
2003	\$147,854.48	\$8,228.94	0.42	\$62,704.73	\$3,489.87
2004	\$156,873.67	\$8,730.90	0.39	\$60,481.55	\$3,366.14
2005	\$166,420.43	\$9,262.23	0.32	\$53,026.67	\$2,951.23
NET PRESENT VALUE				\$751,434.87	\$332,446.07
				DIFFERENCE IN NPV	\$418,988.80

The savings from incorporating PPC 111 is obtained by subtracting the total from column 6 from the total of column 7, a total of \$418,988.80 in FY94 constant dollars.

In conclusion, both the break-even analysis and the comparison of Net Present Values with and without incorporation of PPC 111 show that PPC 111 is, indeed, cost-effective.

VI. SUMMARY, CONCLUSIONS AND RECOMMENDATIONS

A. SUMMARY

The objective of this thesis was to validate the cost-effectiveness of the aircraft engine Component Improvement Program (CIP) for an Engineering Change Proposal (ECP) which was implemented into the fleet as a Power Plant Change (PPC). To achieve this objective, the costs and expected savings (benefits) associated with this CIP effort needed to be determined. The Power Plant Change was PPC 111 for the T56-A-427 engine. PPC 111 replaced the thermocouple interconnector harness end and mating thermocouple end connector which transmit engine temperatures to the Digital Electronic Control (DEC) for controlling engine power changes.

Chapter I provided the thesis objectives, scope and limitations of the research effort, and a preview of this thesis. Chapter II provided a literature review of previous research done on the Component Improvement Program by the Institute for Defense Analysis and the Naval Postgraduate School. Chapter III provided insight into the mechanical operation behind the T56 turboprop engine, the administrative funding process at the Naval Air Systems Command to procure the PPC 111. The chapter also includes a detailed narrative of the author's experiences in developing his methodology for

maintenance data. Chapter III ends with the description of the maintenance data collection process and the information obtained about PPC 111.

In Chapter IV the research and development costs; procurement costs of modification kits; technical directives printing costs; obsolete and reworked equipment costs; test equipment costs; changes in the original E-2C (plus) procurement contract costs and maintenance actions costs were estimated out to the year 2005 for two different life cycle models. The first model presents the expenditures as if PPC 111 had not been incorporated and the second model presents the expenditures with PPC 111 incorporated. The actual cost data for R&D was obtained from the finalized version of the Engineering Program Description (EPD), a document of Allison Gas Turbine Division, General Motors Corporation. The APN cost data was from the Cost and Funding Milestones Chart from NAVAIR's Configuration Change Control Board (CCCCB). The costs of past and expected future maintenance actions were calculated using labor rates obtained from the Naval Center for Cost Analysis' Visibility and Management of Operating Support Costs (VAMOSOC).

Chapter V presented the cost-benefit analyses for PPC. These took two forms; a break-even analysis and a Net Present Value analysis. In the Net Present Value analysis, the author determined the present value of the annual expenditures of the two models using a capital discount rate of 10%. A comparison

of the present worth of the two configurations was then determined by summing the present value of annual cash flows for each.

B. CONCLUSIONS

From the comparison of the life cycle costs with and without PPC 111, it was determined that Power Plant Change 111 is cost-effective. The break-even point was found to occur after year 1997. The difference between the net present value totals of the two alternatives showed a savings in FY94 dollars of \$418,988.80 because of the incorporation of this PPC.

Measuring the effectiveness of the aircraft engine CIP program is a complex process which is further complicated by the difficulties of acquiring maintenance data from the NALDA system, understanding the coordination process between the many offices at Naval Air Systems Command to implement the ECP, and the funding approval process of the Configuration Change Control Board (CCCB).

Because this study only examined one component, the reader is cautioned in interpreting the results of this thesis to be conclusive for every component improved under the CIP program. The author chose his component of study to simplify the data collection process.

C. RECOMMENDATIONS

The author recommends that future CIP program researchers use the data collection methodology used in this thesis to examine maintenance data on a component prior to the Power Plant Change modification. Furthermore, another approach that will aid CIP researchers is the methodology used by Jones'. [Ref. 9] The two data collection methodologies are parallel in structure but use different Equipment Condition Analysis reports to collect maintenance data. The break-even analysis and Net Present Value analysis methodology should also be used in future studies.

The author also recommends that follow-on study of PPC 111 be conducted to validate cost estimates for the rest of the life cycle of the T56 engine. Because this PPC was recently incorporated, there is a high awareness within the E-2C (plus) squadrons pertaining to the improvements that the PPC should have made to the interconnector harness end and mating thermocouple end connector. In particular, maintenance data should be tracked closely using the author's data collection methodology. If reality is different from the estimates then the break-even analysis and Net Present value analysis should be redone.

Finally, the author recommends that additional education and training in the NALDA system be available at the Naval Postgraduate School to faculty and students in the Logistic Management Curriculum. The NALDA database is the primary

source of logistics information for aircraft maintenance and support. If training and access to the system was available at the Naval Postgraduate School, the funding and time constraints involved in traveling to NALDA sites would disappear. Research students would have more time to acquaint themselves with the system and understand its limitations.

LIST OF REFERENCES

1. Department of the Navy, NAVAIR Instruction 5200.35, *Policy, Guidelines and Responsibilities for the Administration of the Aircraft Engine Component Improvement Program (CIP)*, 25 January 1982.
2. McMasters, A.W., Proposal for Research submitted to AIR-536, Naval Postgraduate School, 1 October, 1993.
3. Allison Gas Turbine Division, General Motors Corporation, *T56 CIP-FMS Review*, Indianapolis, Indiana, October, 1991.
4. Nelson, J.R., Harmon, B.R., Tyson, K.W., *Policy Options For The Aircraft Turbine Engine Component Improvement Program*, Institute For Defense Analyses Paper P-2015, May, 1987.
5. Sudol, E.G. and Price, L.D., *Evaluation of Aircraft Turbine Engine Redesigns*, M.S. Thesis, Naval Postgraduate School, June, 1990.
6. Borer, C.J., *An analysis of the Aircraft Engine Component Improvement Program (CIP): A Life Cycle Cost Approach*, M.S. Thesis, Naval Postgraduate School, December, 1990.
7. Butler, R.S., *Preliminary Analysis of the J-52 Aircraft Engine Component Improvement Program*, M.S. Thesis, Naval Postgraduate School, September, 1992.
8. Gordon, L.B., *Analysis of the Correlation Between The J-52 Engine Component Improvement Program and Improved Maintenance Parameters*, M.S. Thesis, Naval Postgraduate School, December, 1992.
9. Jones, M.A., *An Analysis of the Cost and Benefits In Improving the J-52 Fuel Pump Main Gear Spline Under The Aircraft Engine Component Improvement Program (CIP)*, M.S. Thesis, Naval Postgraduate School, June, 1993.
10. Naval Air Systems Command, *E-2C Operational and Safety Requirements Briefing Slide*, Prepared by Naval Air Systems Command PMA-231, Washington D.C., Not dated.
11. Allison Gas Turbine Division, General Motors Corporation, *T56-A-427 Engine Technical Description*, Indianapolis, Indiana, July, 1987.

12. Naval Air Systems Command, *Aircraft Engines Component Improvement Program (CIP) Brief*, Prepared by Naval Air Systems Command, AIR-536 Propulsion and Power Systems Division, Washington D.C., December 1993.
13. Naval Air Systems Command, *Decision Memorandum*, Prepared by Naval Air Systems Command, AIR-536 Propulsion and Power Systems Division, Washington D.C., 25 November, 1991.
14. Allison Gas Turbine Division, General Motors Corporation, *Engine Change Proposal (ECP) No. 2059R3*, 29 October, 1989.
15. Naval Air Systems Command, *Work Unit Code E-2C Technical Manual No. 01-85WB-8*, Commander Naval Air Systems Command, 01 August, 1992.
16. Naval Air Systems Command, *Engine Component Improvement Feedback Report*, Prepared by Naval Air Systems Command, IRM Application Branch AIR-71334, Washington, D.C., 08 August, 1993.
17. Department of the Navy, Naval Air Systems Command, *T56 Power Plant Change No. 111*, Air-4106E/AIR-53622, August, 1992.
18. Telephone conversation between the author and CDR Paul Skoog, OINC, E-2C Fleet Introduction Team, NAS Miramar, San Diego, CA, on 4 March 1994.
19. Discussion between the author and Chief Petty Officer (Aviation Machinist) Debert Valle, Engine Program Manager, E-2C Fleet Introduction Team, NAS Miramar, San Diego, CA, 17 March, 1994.
20. Chief of Naval Operations, Naval Aviation Maintenance Program, OPNAV Instruction 4790.2E, Volume II CH-5, 1 July, 1993.
21. Discussion between the author and Chief Petty Officer (Aviation Administration) Fred Beierly, Maintenance Administration Manager, E-2C Fleet Introduction Team, NAS Miramar, San Diego, CA, 17 March, 1994.
22. Department of the Navy, Naval Air Systems Command, *Technical Manual*, No 02B-5DF-4, 15 December, 1990.
23. Meeting between the author and Mr. Bob Weaver, Information Systems, SYS Company, Crystal City, VA, 25 March, 1994.
24. Department of the Navy, Naval Aviation Depot, North Island, CA, *Message Date Time Group 241629Z Jun 91, Final CAT I TPDR Response*, 24 June, 1991.

25. Telephone conversation between the author and Chief Petty Officer (Aviation Machinist) Debert Valle, Engine Program Manager, E-2C Fleet Introduction Team, NAS Miramar, San Diego, CA, 9 May, 1994.

26. E-2C Fleet Introduction Team, FY Aircraft Summary, Working Document, Chief Petty Officer (Aviation Machinist) Debert Valle, Engine Program Manager, E-2C Fleet Introduction Team, NAS Miramar, CA, Not Dated.

27. Meeting between the author and Mr. Richard J. Williams, T56 Customer Support, Allison Gas Turbine Division, General Motors Corporation, NAS Miramar CA, 17 March, 1994.

28. Telephone conversation between the author and Mr. Tom Ryan, T56 Customer Support, Allison Gas Turbine Division, General Motors Corporation, Indianapolis, IN, 31 March, 1994.

29. Allison Gas Turbine Division, General Motors Corporation. Engineering Program Description No. 5647.107RA; January, 1992.

30. Telephone conversation between the author and Mr. Gray Bergoine, T56 Engineering Programs, Allison Gas Turbine Division, General Motors Corporation, Indianapolis, IN, 3 March, 1994.

31. Meeting conversation between the author and Mr. Dan Peckham, E-2C Propulsion Team Leader, Naval Air Systems Command AIR-536, Washington, D.C., 24 March, 1994.

32. Department of the Navy, Naval Air Systems Command, *Supplemental Agreement With General Motors Corp. Modification Number P00048*, AIR-21123, 29 April, 1992.

33. Telephone conversation between the author and Mr. Alan Doremann from the Naval Center for Cost Analysis (NCA-61) on 24 March, 1994.

34. Telephone conversation between the author and Chief Petty Officer (Aviation Machinist) Debert Valle, Engine Program Manager, E-2C Fleet Introduction Team, NAS Miramar, San Diego, CA, 31 May, 1994.

35. Telephone conversation between the author and Mr. Dan Peckham, E-2C Propulsion Team Leader, Naval Air Systems Command AIR-536, Washington, D.C., 01 June, 1994.

36. Telephone conversation between the author and Chief Petty Officer (Aviation Machinist) Debert Valle, Engine Program Manager, E-2C Fleet Introduction Team, NAS Miramar, San Diego, CA, 20 May, 1994.

37. Telephone conversation between the author and Mr. Gray Bergoine, T56 Engineering Programs, Allison Gas Turbine Division, General Motors Corporation, Indianapolis, IN, 20 May, 1994.

38. Executive Office of the President, Office of the Management and Budget, Washington, D.C., Circular A-94, Revised, *Guidelines and Discount Rates for Benefit-Cost Analysis of Federal Programs*, October 29, 1992.

APPENDIX A

CCB CHANGE REQUEST/DIRECTIVE (SEE EXHIBIT V-8 NAVJAGINST 1330.2)		CLASSIFICATION UNCLASSIFIED		1. PROCESSING RATE <input type="checkbox"/> HAND CARRY <input checked="" type="checkbox"/> PRIORITY <input type="checkbox"/> NORMAL	
TRACTOR/AVIATION ACTIVITY 111000 Gas Turbine Division, GNC		2. BCP NUMBER BCP 2103		3. CCB NUMBER 921-0226	
SUBJECT OF CHANGE AND CLASSIFICATION OF SUBJECT (INDICATE TYPE/MODEL/SERIES AIRCRAFT AFFECTED) 56-A-427 ENGINE THERMOCOUPLE HARNESS FIREWALL CONNECTOR (E-2C+)					
ORIGINATOR Dan Peckham		4. CODE A-53622D	5. EXTENSION 27466	6. DATE PREPARED 12/10/91	7. NATURE OF CHANGE (SEE PG V-8.1 NAVJAGINST 4130.18) R&N
REFERENCES (CITE IN BLOCK 27 OR 28 BELOW) (a) Allison Gas Turbine letter JJC:T91-999 of 17 September 1991					
TRACT NUMBERS 00019-87-C-0372		8. ARTICLES AFFECTED T56-A-427	9. QUANT. OF ARTICLES 17 15 2	10. MANDATORY CONSIDERATIONS	
Prior Contracts		T56-A-427	76 0 76	A. GPE AFFECTED (SEE NAVJAGINST 4340.3A) <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO B. SUPPORT EQUIPMENT AFFECTED <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO C. COMPUTER PROGRAM AFFECTED <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO D. HUMAN FACTORS AFFECTED <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO E. APP REQUIRED (SEE NAVJAGINST 4730.3E) <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO F. COMMONALITY AFFECTED <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO G. FOREIGN MILITARY SALES AFFECTED <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO	
00019-91-C-0245		T56 (KITS BOA)	TOTAL: 93 15 78	H. PROGRAM MANAGEMENT PROPOSAL FORD <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO I. WEIGHT, PERFORMANCE AND SERVICE LIFE LIMITS AFFECTED <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO J. SERVICE LIFE LIMITS AFFECTED <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO K. PERFORMANCE <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO L. COST SAVINGS <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO M. INTERFACE (IDENTIFY OTHER SYSTEMS/SUBSYSTEMS OR EQUIPMENTS AFFECTED) <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO	
PRODUCTION EFFECTIVITY (A/C OR EQUIP. SERIAL NOS. OR BULK LOT NOS. FOR PROD) ESTIMATED <input checked="" type="checkbox"/> FROM S/N 113728 MAR 92 <input type="checkbox"/> RETRO <input type="checkbox"/> FROM <input type="checkbox"/> RETRO		STATUS OF CHANGE <input checked="" type="checkbox"/> NOT STARTED <input type="checkbox"/> STARTED <input type="checkbox"/> COMPLETED			
TECHNICAL DIRECTION CATEGORY 1. 1/1/D 3.0		2. TECHNICAL DIRECTION CATEGORY <input checked="" type="checkbox"/> MAJOR <input type="checkbox"/> MINOR <input type="checkbox"/> ROUTINE <input type="checkbox"/> RECORD			
3. NO. OF TECH DIRECTIVE REQ. TO BE CTD FROM AIR-4113 APT CCB APPROVAL JAVC <input checked="" type="checkbox"/> AWC <input type="checkbox"/> PWC <input type="checkbox"/> PPC <input type="checkbox"/> OTHER (Specify)		4. DELIVERY LEAD TIME (1ST RTN) 1 MONTHS AFTER AUTHORIZATION TO PROCEED			
JUSTIFICATION (INCLUDE REQUIREMENT SOURCE, 3M DATA, B. DEPOT RESPONSIBILITY AND REASONS WHY CHANGE IS NEEDED) The fleet has experienced several failures of the thermocouple harness connector which are attributed to deterioration of the phenolic insulator due to the high temperature and vibration environment of the nacelle. Intermittent open circuits in the thermocouple connector have sent false indications to the digital electronic trim control (DETC) with resulting horsepower decreases. The purpose of this change, which was submitted by reference (a), is to incorporate a new firewall connector that is rated in excess of current nacelle temperature measurements and has passed the vibration/temperature tests. Allison has advance ordered several connectors to protect the production schedule.					
5. AFF NOT REQUIRED. OWS A-10042 8/19/91					
6. INSTRUCTIONS FOR CONTRACTOR, MAINT, NATSP, AND/OR OTHER ACTIVITY (WHO, WHAT, AND HOW MANY) 1. AIR-4106E: Issue implementation letter. 2. AIR-21421: Issue change order 3. AIR-53622D: Issue technical approval letter 4. NATSP: Coordinate pubs 5. AIR-11423E: Issue appropriate funding document for 78 kits 6. PMA-231: Fund NATSP and Issue PD to AIR-535 for API-1 funds. <i>Go to AIR-11423E for API-5 funds.</i> 7. AIR-53622: Prepare PR for Production Nonrecurring.					
7. REPORTS ACTION (CHECK UNDER LETTER AND MARK APPLICABLE BLOCKS)					
<input type="checkbox"/> DETAIL SPEC <input type="checkbox"/> INFO <input type="checkbox"/> AIR SPEC <input checked="" type="checkbox"/> THIS PROVIDED BY ECP		8. QUANTITY OF ARTICLES IN WARRANTY BY TAMS. LESS QUANTITY CHANGED IN PRODUCTION. LESS ATTRITION			
9. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		10. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
11. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		12. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
13. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		14. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
15. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		16. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
17. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		18. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
19. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		20. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
21. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		22. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
23. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		24. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
25. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		26. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
27. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		28. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
29. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		30. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
31. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		32. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
33. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		34. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
35. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		36. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
37. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		38. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
39. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		40. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
41. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		42. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
43. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		44. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
45. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		46. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
47. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		48. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
49. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		50. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
51. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		52. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
53. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		54. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
55. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		56. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
57. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		58. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
59. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		60. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
61. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		62. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
63. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		64. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
65. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		66. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
67. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		68. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
69. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		70. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
71. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		72. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
73. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		74. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
75. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		76. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
77. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		78. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
79. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		80. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
81. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		82. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
83. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		84. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
85. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		86. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
87. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		88. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
89. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		90. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
91. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		92. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
93. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		94. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
95. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		96. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
97. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		98. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			
99. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION		100. QUANTITY OF ARTICLES OUT OF WARRANTY BY TAMS. LESS ATTRITION			

NAVAIR FORM 13050/2 (REV. 2-85) (BACK)				CLASSIFICATION UNCLASSIFIED		CCB NO. 921-0228	
PRICE INFORMATION AND FUNDING SOURCES (PRIOR AND CURRENT FISCAL YEARS ONLY)						PRICES QUOTED GOOD UNTIL DATE N/A	
ACT. KEY	ITEM	PRODUCTION		RETIROIT		TOTAL	FUNDS RESERVED & AVAILABLE INSERT CODE & INITIAL FOR EACH ITEM PRODUCTION RETIROIT
		NAVY	NAVY	NAVY	NAVY		
A	ENG DESIGN DEV & TEST	NICP				NICP	
B	DRAWINGS	NICP				NICP	
C	LABORANT, PLANS/SML						
D	TECH DIR PREPARATION	NICP				NICP	
E	CONV OR PROVISIONING	NICP				NICP	
F	DOVT FURNISHED EQUIPMENT						
G	HTS FOR BASIC EQUIP			78 KITS @ \$67,066	\$567.51 ea	\$67,666	PHA-231D
H	MOD OF BASIC EQUIP	NICP		NICP		NICP	
I	HTS FOR TRAINERS						
J	MOD OF TRAINERS						
K	HTS FOR SPARES						
L	MOD OF SPARES						
M	PUBLICATIONS	NICP				NICP	
N	PUBS & TO PRINTING & DIST				\$450	\$450	PHA-231D
O	NEW SPARES/REPAIR PARTS						
P	INTERIM SPARES						
Q	TRAINING						
R	TRAINERS						
S	SUPPORT EQUIPMENT						
T	BE ILs						
U	BE SPARES						
V	PRODUCTION RECURRING						
W1	Obsolescence		\$10,317			\$10,317	PHA-231D
W2	Rework		\$10,560			\$10,560	
X	Test Bids		\$1,500			\$1,500	PHA-231D
TOTALS			\$22,377		\$68,116	\$90,493	

I. CONCURRENCES (SIGNATURE)		DATE	II. CCB MEMBERS (SIGNATURE)		III. APPROVED	DISAPPROVED
AIR-53622D	COORDINANT ENGINEER		SYSTEMS AND ENGINEERING (AIR-53)	2/27/92		
AIR-5116C	TEST. PROGRAM MGR (SAC)		MAINTENANCE (AIR-53)	2/27/92		
AIR-55231G	INTEGRATED LOGISTICS SUPPORT MANAGER	13/13/92	PROGRAM MANAGER/COORDINATOR			
AIR-4106E	ARMED FOR REPRESENTATION (AIR-111)	3/12/92	CCB CHAIRMAN (AIR-51)			
AIR-410C1	ARMED FOR REPRESENTATION (AIR-111)	3/23/92				
AIR-4106E	ARMED FOR REPRESENTATION (AIR-111)	3/23/92				
PHA-231B/A	ARMED FOR REPRESENTATION (AIR-111)	3/21/92				
AIR-5511B2	ARMED FOR REPRESENTATION (AIR-111)	3/21/92				
AIR-51651	ARMED FOR REPRESENTATION (AIR-111)	3/21/92				
AIR-11433B	ARMED FOR REPRESENTATION (AIR-111)	3/21/92				

Presented by D. R. Krum, AIR-53622D, 27446
DATE 03/26/92

ACTION	ACTION KEY(S)	ACTION CODE	ACTION REQ'D M/I DATE	OTHER INFORMATION
CHANGE ORDER	W1, W2, X	AIR-21421		PHA-231 PD to AIR-536, AIR-536 funding FR to AIR-21
IMPLEMENTATION LETTER	ALL	AIR-4106E		
TECHNICAL DIRECTIVE	D, E	AIR-4106E		
APR 5362 LTR TO SAALC, KELLY APB	ALL	AIR-53622D		Tech. Approval ltr
PROCUREMENT REQUEST	G	AIR-11423F		Kits
MILITARY INTERDEPARTMENTAL PURCHASE REQUEST				
MASTER OVERPRINT FURNISHED EQUIPMENT LIST CHANGE				
Coordinate Pubs	M, N	NATSF		PHA-231 to fund NATSF
REQUESTION OR ALLOTMENT				

CC AND FUNDING SUMMARY

SHEET 1 OF 1

921-0228

☐ ATTRITION ECP RAMEC NO. 2103 LOGISTICS MANAGER AIR-4106E CCB NO. D21-0168
☒ PRODUCTION ECP ORIGINATOR ALLISON GAS TURB. EQUIPMENT AFFECTED T56-A-427 TD NO. PPC-
☒ RETROFIT ECP SPONSOR AIR-53622D OSIP NO. P-92 TD CATEGORY ROUTINE

ELEMENT	INSTAL H/WRS 3.0	QTY BY FY			CCB KEY	TASKED ACTIVITY	IMPL ACTY (AIR CODE)	TYPE FUNDS	(FY 92) FUNDING		(FY 93) FUNDING		(FY 94) FUNDING	
		92	93	94					COST	APPROVAL	COST	APPROVAL	COST	APPROVAL
1. NONRECURRING ENGINEERING														
A. DESIGN/DEVELOPMENT AND TEST					A	AGTD	AIR-536		NKP					
B. DRAWINGS					B	AGTD	AIR-536	R&D	NICP					
2. NONRECURRING ILS														
A. LSA/MAINTENANCE PLANS/SML					C									
B. TECH DIRECTIVE PREPARATION					D	AGTD	AIR-4106E	APN-1	NICP					
C. DCM's ON PROVISIONING					E	AGTD	AIR-4106E	APN-1	NICP					
3. GFE														
4. MODIFICATION COSTS														
A. KITS FOR BASIC EQUIPMENT		78			G	AGTD	AIR-536	APN-5	\$67,666	PNA-231D				
B. MOD OF BASIC EQUIPMENT			10	40	20	H	O, I & D	TYCON	ONAN	UTM	TYCON	UTM	TYCON	UTM
C. KITS FOR MAINT. TRAINERS					I	CONTRACTOR SUPPORT								
D. MOD OF MAINT. TRMR					J									
E. KITS FOR OPS TRAINERS					I									
F. MOD OF OPS TRMR					J									
G. KITS FOR SPARES					K									
H. MOD OF SPARES					L									
5. SUPPORT COSTS														
A. PUBLICATIONS					M	AGTD	KATSF	APN-1	NICP					
B. PUBS PRINT & DISTRIBUTION					M	NPPSO	KATSF	APN-1	NICP					
C. TD PRINT & DISTRIBUTION					M	NPPSO	KATSF	APN-5	\$450	PNA-231D				
D. NEW SPARES/REPAIR PARTS					O									
E. INTERIM SPARES					P									
F. TRAINING					Q									
G. TRAINERS (NEW/MONRECURRING)					R									
H. SE NEW/MONREC (13050/2C)					S									
I. SE ILS					T									
J. SE SPARES/REPAIR PARTS					U									
6. PRODUCTION RECURRING														
7. OBSOLESCENCE					W1	AGTD	AIR-536	APN-1	\$10,317	PNA-231D				
8. REMORK					W2	AGTD	AIR-536	APN-1	\$10,560	PNA-231D				
9. TEST EQUIPMENT					X	AGTD	AIR-536	APN-1	\$1,500	PNA-231D				
PREPARED BY: <u>ADCS WAYNE ANDERSON</u> CODE: <u>4106E</u> PHONE: <u>692-9126</u> DATE: <u>3/19/92</u> AIR-04 APPROVAL: <u>12 Maydon</u> CODE: <u>AIR 4106</u> DATE: <u>3/19/92</u>														

MILESTONE CHART

SHEET 1 OF 1

<input type="checkbox"/>	ATTRITION	ECP NO. <u>2103</u>	LOGISTICS MANAGER <u>AIR-4106E</u>	CCB NO. <u>921-0228</u>	
<input checked="" type="checkbox"/>	PRODUCTION	ECP ORIGINATOR <u>ALLISON</u>	EQUIPMENT AFFECTED <u>T56-A-427 ENGINES</u>	TD NO. <u>PPC-</u>	
<input checked="" type="checkbox"/>	RETROFIT	ECP SPONSOR <u>AIR-53622D</u>	OSIP NO. <u>P-92</u>	TD CATEGORY <u>ROUTINE</u>	

ELEMENT	QTY BY FY			TASKED ACTIVITY	FY 92 CY 92												FY 93 CY 93												FY 94 CY 94																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																					
	92	93	94		O	N	D	J	F	M	A	M	J	J	A	S	O	N	D	J	F	M	A	M	J	J	A	S	O	N	D	J	F	M	A	M	J	J	A	S																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																										
1. PROCUREMENT																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																		

REMARKS :



Allison
GAS TURBINE DIVISION
General Motors Corporation



ENGINEERING PROGRAM DESCRIPTION

E.P.D. NO. 5647.1.07RA

PROPOSED ACTIVE X INACTIVE COMPLETED

PROGRAM TITLE

PRIORITY

P

Thermocouple Harness Firewall

PROGRAM START DATE 5/90

Connector

PROGRAM REV. DATE 5/90

MODELS AFFECTED T56-A-427 (Series IV)

DATE OF FORM 2/91

CLOSING ACTION

APPROVED

James T. Dillard
CHIEF PROJECT ENGINEER

PROBLEM DEFINITION/CAUSE/BACKGROUND

The E-2 aircraft has experienced intermittent thermocouple signal flutter. A flutter in the thermocouple signal fails DEC because DEC thinks the engine is hotter than it actually is due to intermittent open circuit. This problem has been traced to the firewall connector. This connector completes the circuit from the thermocouple harness to the innerconnector harness. The cause of signal flutter is due to pins vibrating in the connector's electrical receptor.

The T/C harness to I/C harness was initially designed into the 427 from Series III engines. The connector has been in use for over 30 years in the field. Military Standard MIL-C-5015 describes the connector. The connector is a safety wired style connector.

IMPACT OF PROBLEM

HAZARD ASSESSMENT IV-B Negligible/Reasonably Probable

OVERHAUL COSTS NO

IN-FLIGHT SHUTDOWNS NO

SPARE/REPLACEMENT PART COSTS YES

FIELD UNSCHEDULED ENGINE REMOVALS (UER'S) YES

INCIDENT HISTORY

There are five field service reports (FSR's) generated against the T/C Firewall Connector. This Connector is causing an intermittently open circuit, which causes abnormal temperature indications during starts and engine operation.

The Navy fleet crews have developed a procedure that will start the engine. This procedure defeats the temperature limiter by switching engine control off the temperature signal. This can result in an engine failure if the connector problem is confused with a mechanical problem.

PROGRAM COST

PREVIOUS YEAR	CURRENT YEAR (1990)	NEXT YEAR (1991)	COST TO COMPLETE	TOTAL COST
\$ <u>-0-</u>	\$ <u>80,000</u>	\$ <u>-0-</u>	\$ <u>-0-</u>	\$ <u>80,000</u>

EQUIPMENT CONDITION ANALYSIS

PREPARED: 31 MAR 1994

REPORT PERIOD: JAN 89 THRU JAN 94

T/M: E2

[illegible]

TYPE	BUREAU	WORK											ENT	MAINT	O									
EQPT	SERIAL	UNIT	MFG	***** JCM *****			M	METER	T	W	M	ACT	ACT	A	MAL	OR	MAN-	R						
CODE	NUMBER	CODE	PI	PART	NUMBER	CODE	SERIAL	NBR	ORG	DATE	REF	SUP	C	TIME	M	D	L	ORG	DATE	T	CODE	DAT	HOURS	R

AEBC 163848 2230370	Z3032692	90625 092	PR2 92189 333	A 1496	B R 1 PR2 92197 R 170	6.5	12.5
	Z3032692	90906 0000		E 1484			
					2 P9C 92212 D 000	3.0	3.0
AEBC 163849 29E1M20	Z3032692	81629 055	PR2 93080 240	E 2148	B H 1 PR2 93125 R 450	10.4	20.3
	Z3032692	81625 081		E 2148			
	Z3032692	63005 023		A 1976	2 D9K 93089 C 070	3.6	4.0

FAILED PARTS ASSOCIATED
WITH THE ABOVE ARE:

PART NUMBER	REF SYMBOL	MFG CODE	A T	MAL CODE	M QTY	DATE L PRI	REQ ORD	DATE NBR	RCVD
3642138	COM REC	71468	R	615	01 2	02 93083	0188	93089	

AEBC 163848 29E1M20	23032692	63005 046	PR2 93089 370	E 1861	B H 1 PR2 93091 R 160	9.5	19.5
	23032692	81625 053		E 1861			
					2 D9K 93091 9 615	9.3	9.3
AEBC 163848 29E1M20	23032692	81625 023	PR2 93098 360	A 1976	B H 1 PR2 93099 R 615	15.5	40.0
	23032692	81625 068		A 1875			
					2 D9K 93099 A 160	4.0	6.0
TMZA 383303 2230000	23032692	81625 023	D8K 93099 898	E 1298	B O 2 D9K 93099 9 160	16.0	21.0
	23032692	81625 000		E 1298			
TMZA 383303 2230000	23032692	81625 023	D8K 93111 801	E 0000	B O 2 D9K 93111 T 814	0.0	0.0
	23032692	81625 023		E 0000			
AEBC 163851 2230360	23032692	63005 0	PR4 93119 005	E 0709	D L 2 P9C 93140 1 374	0.0	0.0
AEBC 163697 2230360	23032692	63005 056	PR7 93138 377	E 1535	B H 1 PR7 93141 R 020	7.0	12.3
	23032692	63005 042		E 1535			
					2 P9C 93140 1 374	0.0	0.0
AEBC 163697 2230360	23032692	63005 093	PR7 93138 383	E 1502	B H 1 PR7 93141 R 103	4.8	9.6
	23032692	63005 174		E 1502			

AEAC 163539 29E1M20 23032692 81625 150 PR2 93157 138 E 2319 B H 1 PR2 93176 C 160 17.0 34.0

FAILED PARTS ASSOCIATED
WITH THE ABOVE ARE:

PART NUMBER	REF SYMBOL	MFG CODE	A T	MAL CODE	M QTY	M L	DATE PRI	ORD	REQ NBR	DATE RCVD
2104306		96906	R	117	01	1	02	93157	0951	93157
3032692		50625	R	160	01	1	02	93157	G902	93157

						2 DPK 93163 9 615	6.0	6.9
AESC 164107 2230370	23032692	63005 102	PR4 93293 005	A 1859	B H 1	PR4 93298 R 160	5.5	11.0
						2 PDC 93295 1 374	0.0	0.0
TKZA 343790 2230370	23032692	63005 000	P8C 93306 918	E 1298		2 PDC 93301 C	2.0	2.0

PAGE

T/M: E2

74

REPORT NBR: R0530
 PREPARED: 29 MAR 1994

EQUIPMENT CONDITION ANALYSIS

PAGE 2

DETAILED MAINTENANCE ACTION RECORD
 REPORT PERIOD: JAN 89 THRU JAN 94

WM: E2

EQUIPMENT										MAINTENANCE ACTION/DESCRIPTION																	
										CT I																	
TYPE	BUREAU	WORK								EMT	MAINT	OY	C	DRCT													
PT	SERIAL	UNIT	MFG	***** JCM *****				M	METER	T	W	M	ACT	ACT	A	MAL	OR	MAN-	RP	C	MATL	C					
DE	NUMBER	CODE	PI	PART	NUMBER	CODE	SERIAL	NBR	ORG	DATE	SEG	SUF	C	TIME	M	D	L	ORG	DATE	T	CODE	DAY	HOURS	RE	C	COST	C
ZA	113182	2230000		23030745	63005	0		PR7	93245	331			E	0521		1	PR7	93247	C			10.0	10.4			E	
BC	164107	29E1M00		23038786	63005	12672		PR4	93280	014	B		E	1758	B	A	1	PR4	93281	R	160	21.0	42.0			E	
				23038786	63005	12872							E	1758												Q	
				23038786	63005	086							E	1758		2	P9C	93283	1	374		0.0	0.0			E	
BC	164495	42B1100		23038786	63005	017		PR2	94027	100			E	0386	B	H	2	P9C	94027	1	374	0.0	0.0			E	

APPENDIX C

The following is a list of acronyms as they are used in this in this thesis:

CIP	Component Improvement Program
AIR	Naval Air Systems Command
ECP	Engineering Change Proposal
O&MN	Operations and Maintenance Navy
FIT	Fleet Introduction Team
LCC	Life Cycle Cost
IDA	Institute for Defense Analyses
FSD	Full Scale Development
ECIFR	Engine Component Improvement Feedback Report
PPC	Power Plant Change
MTBF	Mean Time Between Failures
VAMOSC	Visibility and Management of Operations and Support
NCA	Navy Center for Cost Analysis
MFHBMA	Mean Flight Hours Between Maintenance Actions
MMH/MA	Mean Maintenance Hour per Maintenance Action
NALDA	Naval Aviation Logistics Data Analysis
3M	Maintenance, Material, and Management
NADEP	Naval Aviation Depot
ECA	Equipment Condition Analysis
RDT&E	Research Development Test and Evaluation
EPD	Engineering Project or Program Description
APN	Aircraft Procurement Navy

CCCB	Configuration Change Control Board
MODMIS	Modification Management Information System
DEC	Digital Electronic Control
TMT	Turbine Measured Temperature
FMS	Foreign Military Sales
PMA	Program Manager for Acquisition
CFA	Cognizant Field Activity
VIDS/MAF	Visual Information Display/ Maintenance Action Form
FIT	Fleet Introduction Team
HMR	Hazardous Material Report
NPV	Net Present Value

DISTRIBUTION LIST

	No. Copies
1. Library, Code 52 Naval Postgraduate School Monterey, California 93943-6145	2
2. Defense Technical Information Center Cameron Station Alexandria, Virginia 22304-6145	2
3. Professor Alan W. McMasters, Code SM/MG Department of Systems Management Naval Postgraduate School Monterey, California 93943-5103	2
4. Professor Keebom Kang, Code SM/KK Department of Systems Management Naval Postgraduate School Monterey, California 93943-5103	1
5. Commander Naval Air Systems Command Code 536B Washington, DC 20361-5360	1
6. Defense Logistics Studies Information Exchange U.S. Army Logistics Management Center Fort Lee, VA 23801-6043	1
7. Mr. Scott Cote', Code 6052 Naval Air Warfare Center Propulsion Division Warminster, PA 18974-5000	2
8. Officer In Charge Fleet Introduction Team Naval Air Station Miramar San Diego, CA 92145	1
9. Mr. Dan Peckham Naval Air Systems Command Code 53612C Washington, DC 20361-5360	1

- | | | |
|-----|--|---|
| 10. | Mr. Burham V. Adam
Naval Air Systems Command
Code 53612C
Washington, DC 20361-5360 | 2 |
| 11. | Assistant Chief of Naval Operations (Air Warfare)
Head Aviation Programs Branch Code N881
Office of the Chief of Naval Operations
Washington, DC 20350-2000 | 1 |
| 12. | Assistant Commander for Logistics and Fleet Support
Naval Air Systems Command
Code 04
Washington, DC 20361-5360 | 1 |
| 13. | Commander
Naval Air Systems Command
Code 410
Washington, DC 20361-5360 | 1 |
| 14. | LCDR Thomas Joseph Murphy
1717 3rd. ST. N.E.
Austin, Minnesota 55912 | 1 |

DUDLEY KNOX LIBRARY
NAVAL POSTGRADUATE SCHOOL
MONTEREY, CA 93943-5101

DUDLEY KNOX LIBRARY



3 2768 00308479 9